



FIGURE 27. INSTALLING THE S-METER

- ✓ Push the meter assembly forward until the meter window is positioned against the front panel. Tighten the mounting screws.
- ✓ Secure the meter window in place by taping across the top and down both sides. Press down the tape already on the bottom edge.

- ✓ Insert the dial light in its socket. Mount the dial light socket on the S-METER mounting bracket. Use a 4-36 x 3/8" screw, lockwasher, and nut.
- ✓ Solder the wire from the pilot light to terminal 1 of TS-6.