ASME/ANSI B1.8-1988

(REVISION OF ANSI B1.8-1977)

REAFFIRMED 1994

FOR CURRENT COMMITTEE PERSONNEL PLEASE SEE ASME MANUAL AS-11

STUB ACME SCREW THREADS

AN AMERICAN NATIONAL STANDARD



The American Society of Mechanical Engineers

STUB ACME SCREW THREADS

ASME/ANSI B1.8-1988

(REVISION OF ANSI B1.8-1977)



The American Society of Mechanical Engineers

Date of Issuance: April 30, 1988

This Standard will be revised when the Society approves the issuance of a new edition. There will be no addenda or written interpretations of the requirements of this Standard issued to this edition.

This code or standard was developed under procedures accredited as meeting the criteria for American National Standards. The Consensus Committee that approved the code or standard was balanced to assure that individuals from competent and concerned interests have had an opportunity to participate. The proposed code or standard was made available for public review and comment which provides an opportunity for additional public input from industry, academia, regulatory agencies, and the public-at-large.

ASME does not "approve," "rate," or "endorse" any item, construction, proprietary device, or activity.

ASME does not take any position with respect to the validity of any patent rights asserted in connection with any items mentioned in this document, and does not undertake to insure anyone utilizing a standard against liability for infringement of any applicable Letters Patent, nor assume any such liability. Users of a code or standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, is entirely their own responsibility.

Participation by federal agency representative(s) or person(s) affiliated with industry is not to be interpreted as government or industry endorsement of this code or standard.

ASME accepts responsibility for only those interpretations issued in accordance with governing ASME procedures and policies which preclude the issuance of interpretations by individual volunteers.

No part of this document may be reproduced in any form, in an electronic retrieval system or otherwise, without the prior written permission of the publisher.

Copyright © 1988 by
THE AMERICAN SOCIETY OF MECHANICAL ENGINEERS
All Rights Reserved
Printed in U.S.A.

FOREWORD

(This Foreword is not part of ASME/ANSI B1.8-1988.)

The Standards Committee on the Standardization and Unification of Screw Threads, B1, was organized in June 1921 with the Society of Automotive Engineers and the American Society of Mechanical Engineers as joint sponsors under the procedures of the American Standards Association (ASA), now the American National Standards Institute (ANSI). This Committee was reorganized in May 1929, and its work was divided among five subcommittees as follows:

No. 1 — Scope and Arrangement of American Standard

No. 2 — Terminology and Form Threads, Except Gages

No. 3 — Special Threads and Twelve Pitch Series, Except Gages

No. 4 — Acme Threads, Except Gages

No. 5 — Screw Thread Gages

National standardization of Acme screw threads in the United States began in 1932 when Subcommittee No. 4 on Acme Threads of Sectional Committee B1 held its first meeting in New York. A report was presented on the types of Acme threads and the range of sizes and pitches in use in this country. It was prepared by C. W. Bettcher with the assistance of F. L. Woodcock. This report developed into a draft standard. When it was finally approved as an American Standard with the designation ASA B1.3-1941, it contained a section of introductory notes and tables covering general purpose screws and general purpose nuts, basic dimensions of general purpose Acme threads with special and standard pitches, basic dimensions of 29 deg. stub threads, measurements over three wires for Acme threads, basic dimensions of 60 deg. stub threads, and basic proportions for modified square threads.

In December 1942, to meet the war emergency, the National Aircraft Standards Committee of the Aeronautical Chamber of Commerce requested the ASA to consider establishing an American war standard for special Acme screw threads for use in aircraft construction. Recognizing the vital importance of aircraft production to the war effort, the ASA at once initiated this project and organized a special committee to develop the standard. At the London Conference on the unification of screw threads held in the summer of 1944, it was proposed that a war standard on Stub Acme threads also be drawn up. Early in March 1945, therefore, the work on this proposed standard was begun and a draft prepared as a result of the discussion with the British and Canadian experts at the Ottawa Conference in October 1945. This draft was dated March 1946 and was submitted to the ASA War Committee on Acme Threads and the ASA War Committee on Screw Threads in April 1946 for approval by letter ballot. However, a Stub Acme war standard was never issued.

In April 1946, the Subcommittees of Standards Committee B1 were reorganized to include the responsibility of the ASA War Committee. Subcommittee No. 2 on Acme and Stub Acme Threads revised the March 1946 draft on Stub Acme screw threads and on March 31, 1948, distributed the January 1948 draft to industry for criticism and comment.

The final draft of the proposed standard on Stub Acme screw threads was completed in June 1951 and was submitted to Sectional Committee B1 for letter ballot on September 17, 1951; it was approved with minor amendments. Following approval by the sponsor

organizations, the proposed standard was submitted to the ASA for approval and designation as an American Standard. This was granted on May 7, 1952.

The next revisions were approved by ANSI as American National Standards on May 14, 1973, and May 11, 1977, respectively. Revisions were minor.

On September 2, 1981, the B1 Committee was reorganized as an ASME Standards Committee. The B1.8 Subcommittee developed this edition, which was subsequently approved by the ASME B1 Committee, submitted to ANSI, and adopted as an American National Standard on January 11, 1988.

ASME STANDARDS COMMITTEE B1 Standardization and Unification of Screw Threads

(The following is the roster of the Committee at the time of approval of this Standard.)

OFFICERS

D. J. Emanuelli, Chairman H. W. Ellison, Vice Chairman C. E. Lynch, Secretary

COMMITTEE PERSONNEL

AEROSPACE INDUSTRIES ASSOCIATION OF AMERICA, INC.

- G. G. Gerber, McDonnell Douglas Corp., St. Louis, Missouri
- H. Borrman, Alternate, Sperry Defense Electronics, Great Neck, New York

AMERICAN MEASURING TOOL MANUFACTURERS ASSOCIATION

- R. Dodge, Pennoyer-Dodge Co., Glendale, California
- C. W. Jatho, Alternate, American Measuring Tool Manufacturers Association, Birmingham, Michigan

AMERICAN PIPE FITTINGS ASSOCIATION

W. C. Farrell, Jr., Stockham Valves and Fittings, Inc., Birmingham, Alabama

DEFENSE INDUSTRIAL SUPPLY CENTER

- E. Schwartz, Defense Industrial Supply Center, Philadelphia, Pennsylvania
- F. S. Ciccarone, Alternate, Defense Industrial Supply Center, Philadelphia, Pennsylvania

ENGINE MANUFACTURERS ASSOCIATION

G. A. Russ, Cummins Engine Co., Columbus, Indiana

INDUSTRIAL FASTENERS INSTITUTE

- R. M. Harris, Bethlehem Steel Corp., Lebanon, Pennsylvania
- K. E. McCullough, SPS Technologies, Inc., Newton, Pennsylvania
- J. C. McMurray, Russell, Burdsall & Ward Corp., Cleveland, Ohio
- J. A. Trilling, Holo-Krome Co., West Hartford, Connecticut
- C. J. Wilson, Industrial Fasteners Institute, Cleveland, Ohio

MANUFACTURERS STANDARDIZATION SOCIETY OF THE VALVE AND FITTINGS INDUSTRY

W. C. Farrell, Jr., Stockham Valves and Fittings, Inc., Birmingham, Alabama

METAL CUTTING TOOL INSTITUTE (TAP & DIE DIVISION)

- N. F. Nau, Union/Butterfield Division, Litton Industrial Products, Athol, Massachusetts
- A. D. Shepherd, Jr., Alternate, Union/Butterfield Division, Litton Industrial Products, Derby Line, Vermont

NATIONAL ELECTRICAL MANUFACTURERS ASSOCIATION

- J. B. Levy, General Electric Co., Schenectady, New York
- F. F. Weingruber, Westinghouse Electric Corp., Pittsburgh, Pennsylvania
- T. A. Farkas, Alternate, National Electrical Manufacturers Association, Washington, D.C.

NATIONAL FASTENER DISTRIBUTORS ASSOCIATION

J. F. Sullivan, Accurate Fasteners, Inc., Boston, Massachusetts

NATIONAL MACHINE TOOL BUILDERS ASSOCIATION

- R. J. Sabatos, The Cleveland Twist Drill Co., Cleveland, Ohio
- B. V. Shook, Teledyne Landis Machine Co., Waynesboro, Pennsylvania

NATIONAL SCREW MACHINE PRODUCTS ASSOCIATION

R. Zahniser, Alternate, National Screw Products Association, Brecksville, Ohio

SOCIETY OF AUTOMOTIVE ENGINEERS

H. W. Ellison, General Motors Corp., Warren, Michigan

SOCIETY OF MANUFACTURING ENGINEERS

- D. M. Davidson, Lone Star Grinding Co., Southfield, Michigan
- L. E. Gibson, Alternate, Lone Star Grinding Co., Houston, Texas

TUBULAR RIVET AND MACHINE INSTITUTE

R. M. Byrne, Trade Association Management Inc., Tarrytown, New York

U.S. DEPARTMENT OF THE ARMY

- R. S. LaNier, U.S. Army Watervliet Arsenal, Watervliet, New York
- M. E. Taylor, U.S. Army Armament, Munitions and Chemical Command, Dover, New Jersey
- F. L. Jones, Alternate, U.S. Army Missile Command, Redstone Arsenal, Alabama

U.S. DEPARTMENT OF DEFENSE

E. Schwartz, Defense Industrial Supply Center, Philadelphia, Pennsylvania

U.S. DEPARTMENT OF THE NAVY

C. T. Gustafson, Metrology Laboratory, Portsmouth Naval Shipyard, Portsmouth, New Hampshire

INDIVIDUAL MEMBERS

- J. E. Boehnlein, PMC Industries, Wickliffe, Ohio
- A. R. Breed, Lakewood, Ohio
- R. Browning, Southern Gage Co., Erin, Tennessee
- A. Butovich, Air Industries Corp., Garden Grove, California
- R. S. Chamerda, The Johnson Gage Co., Bloomfield, Connecticut
- P. H. Drake, Hudson, Massachusetts
- D. J. Emanuelli, Greenfield Tap & Die, Greenfield, Massachusetts
- C. G. Erickson, Sterling Die Operation, West Hartford, Connecticut
- J. O. Heize, Regal Beloit Corp., South Beloit, Illinois
- S. P. Johnson, The Johnson Gage Co., Bloomfield, Connecticut
- S. I. Kanter, The Hanson-Whitney Co., Hartford, Connecticut
- M. M. Schuster, Hi-Shear Corp., Torrance, California
- R. E. Seppey, Allied/Bendix Aerospace Corp., South Bend, Indiana
- A. G. Strang, Boyds, Maryland
- R. L. Tennis, Caterpillar Tractor Co., Peoria, Illinois
- A. F. Thibodeau, Swanson Tool Manufacturing, Inc., West Hartford, Connecticut

PERSONNEL OF SUBCOMMITTEE NO. 8 — STUB ACME SCREW THREADS

- D. Davidson, Chairman, Lone Star Grinding Co., Southfield, Michigan
- A. G. Strang, Secretary, Boyds, Maryland
- J. E. Boehlein, PMC Industries, Wickliffe, Ohio
- R. Chamerda, The Johnson Gage Co., Bloomfield, Connecticut
- D. J. Emanuelli, Greenfield Tap & Die, Greenfield, Massachusetts
- G. A. Flannery, Mercury Gage Co., Detroit, Michigan
- S. I. Kanter, The Hanson-Whitney Co., Hartford, Connecticut
- P. Scheren, Pratt & Whitney Aircraft Division, East Hartford, Connecticut

CONTENTS

	dards Committee Roster	iii v
Gene 1 2	eral and Historical	1 1 5
Figu	ires	
1	Stub Acme Form of Thread	2
2	Disposition of Allowances, Tolerances, and Crest Clearances for Stub Acme Threads	3
Tabl	les	
1	Tolerances on Major and Minor Diameters of External and	
	Internal Threads	4
2	Stub Acme Screw Thread Form, Design Dimensions	8
3	Stub Acme Screw Threads, Standard Series, Basic Dimensions	9
4	Tolerances and Allowances for Major and Minor Diameters, Stub Acme Screw Threads, Standard Series	10
5	Pitch Diameter Allowances for Stub Acme Screw Threads	11
6	Pitch Diameter Tolerances for Stub Acme Screw Threads	12
7	Limiting Dimensions and Tolerances, Stub Acme Screw Threads,	
8	Standard Series	13 15
9	Tolerances for GO and NOT GO Thread Working and	13
	Setting Gages, Stub Acme Screw Threads	15
10	Pitch Diameter Compensation for Adjusted Lengths of	
	GO Ring Gages	16
	endices	
Α	Alternative Stub Acme Threads, Modified Form 1 and	17
В	Modified Form 2 Three-Wire Method of Measurement of Pitch Diameter of	17
Б	29 deg. Stub Acme Threads	21
Figu	ıres	
Al	Modified Stub Acme Thread With Basic Height of 0.375p (Form 1)	18
A2	Modified Stub Acme Thread With Basic Height of 0.250p (Form 2)	18
B1	Basis of Lead Angle Correction for External Thread	28

Tabl	es	
A 1	Modified Stub Acme Thread Form, Design Dimensions (Form 1)	19
A2	Modified Stub Acme Thread Form, Design Dimensions (Form 2)	20
B1	Wire Sizes and Constants, Single-Start Stub Acme Threads	
	(29 deg.)	22
B2	Values for Wire Measurements of Single-Start Standard Stub	
	Acme Threads (29 deg.)	23
B3	Values of $(1 + \csc \alpha')$ for $\alpha = 14$ deg. 30 min and Lead	
	Angles From 0 deg. to 5 deg.	24
B4	Best-Wire Diameters and Constants for Large Lead Angles, 1 in.	
	Axial Pitch Stub Acme Threads (29 deg.)	26

STUB ACME SCREW THREADS

GENERAL AND HISTORICAL

When formulated prior to 1895, regular Acme screw threads were intended to replace square threads and a variety of threads of other forms used chiefly for the purpose of producing traversing motions on machines, tools, etc. For current information on Acme threads, see the latest edition of ASME/ANSI B1.5.

The Stub Acme thread came into being early in the 1900s. Its use has been generally confined to those unusual applications where a coarse-pitch thread of shallow depth is required due to mechanical or metallurgical considerations.

Federal Government Use. When this Standard is approved by the Department of Defense and Federal Agencies and is incorporated into FED-STD H28/13, Screw Thread Standards for Federal Services, Section 13, the use of this Standard by the Federal Government is subject to all the requirements and limitations of FED-STD H28/13.

1 SPECIFICATIONS FOR STUB ACME THREADS

1.1 Angle of Thread

The included angle between the flanks of the thread measured in an axial plane shall be 29 deg. The line bisecting this 29 deg. angle shall be perpendicular to the axis of the screw thread.

1.2 Pitch of Thread

The pitch of a thread is the distance, measured parallel to its axis, between corresponding points on adjacent thread forms.

1.3 Height of Thread

The basic height of the standard Stub Acme thread shall be equal to 0.3 pitch. When design requirements necessitate use of a lesser or greater thread height, the data should be obtained from Appendix A.

1.4 Thickness of Thread

The basic thickness of the thread at a diameter smaller than the basic major diameter (i.e., the basic pitch diameter) by 0.3 pitch shall be equal to one-half the pitch.

1.5 Allowance (Minimum Clearance) at Major and Minor Diameters

A minimum diametral clearance is provided at the minor diameter of all Stub Acme thread assemblies by establishing the maximum minor diameter of external threads 0.020 in. below the basic minor diameter on threads 10 pitch and coarser, and 0.010 in. below the basic minor diameter for finer pitches.


A minimum diametral clearance at the major diameter is obtained by establishing the minimum major diameter of the internal thread 0.020 in. above the basic major diameter for threads 10 pitch and coarser, and 0.010 in. above the basic major diameter for finer pitches.

1.6 Basic Thread Form Dimensions

The basic dimensions of the Stub Acme thread form for the most generally used pitches are given in Table 2. The basic thread form is symmetrical and is illustrated in Fig. 1.

1.7 Stub Acme Screw Thread Series

The series of diameters and associated pitches of Stub Acme threads listed in Table 3 are recommended as preferred. These diameters and pitches have been carefully selected to meet the present needs with the fewest number of items in order to reduce to a minimum the inventory of both tools and gages. If other combinations of diameter and pitch are required, calculate thread dimensions in accordance with the formulas in Fig. 2.

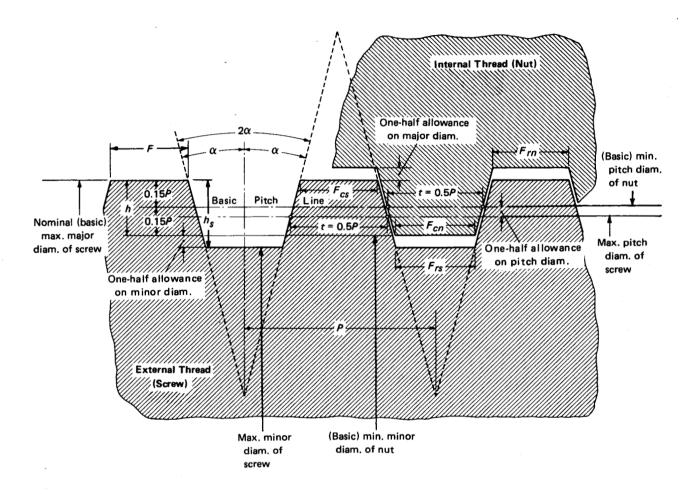

 $2\alpha = 29 \deg$.

 $\alpha = 14 \deg. 30 \min$

P = pitch

n = number of threads/in.


N = number of turns/in.

h = 0.3P, basic thread height

 $F_{cn} = 0.4224P$, basic width of flat of crest of internal thread

 $F_{cs} = 0.4224P - 0.259 \times \text{(pitch diameter allowance on external thread)}$ $F_{rm} = 0.4224P - 0.259 \times \text{(major diameter allowance of internal thread)}$ $F_{rs} = 0.4224P - 0.259 \times \text{(minor diameter allowance on external thread)}$ ance on external thread)

FIG. 1 STUB ACME FORM OF THREAD

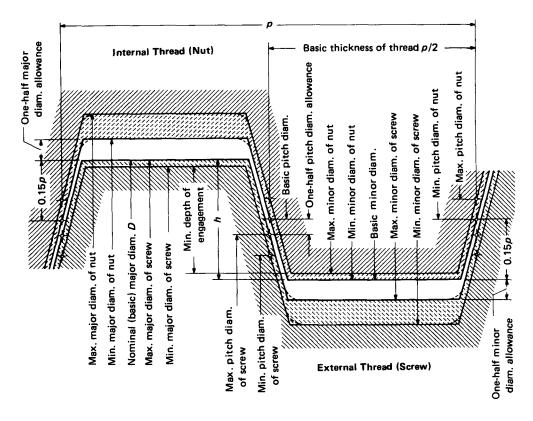

Formulas for Determining Diameters

External Threads (Screws)

(Basic) max. major diam. = nominal size or diameter D

min. major diam. = external max. major diam. minus tolerance from Table 1, column 1 max. pitch diam. = internal min. pitch diam. minus allowance from Table 5, column 3

min. pitch diam. = external max. pitch diam. minus tolerance from Table 6

max. minor diam. = internal min. minor diam. minus allowance from para. 1.5

min. minor diam. = external max. minor diam. minus tolerance from Table 1, column 3

Internal Threads (Nuts)

min. major diam. = external max. major diam. plus allowance from para. 1.5

max. major diam. = internal min. major diam. plus tolerance from Table 1, column 2

(Basic) min. pitch diam. = external max. major diam. minus basic thread height from Table 3,

column 8

max. pitch diam. = internal min. pitch diam. plus tolerance from Table 6

(Basic) min. minor diam. = external max. major diam. minus 2 x basic thread height from Table 2,

column 3

max. minor diam. = internal min. minor diam. plus tolerance from Table 1, column 4

p = pitch

h = basic thread height

FIG. 2 DISPOSITION OF ALLOWANCES, TOLERANCES, AND CREST CLEARANCES FOR STUB ACME THREADS

1.8 Classification and Tolerances, Stub Acme Screw Threads

Only one class of thread for general usage is established herein. This class corresponds to Class 2G (general purpose) of the American National Standard on Acme Threads, ASME/ANSI B1.5. If a fit having less backlash is required, the tolerances and allowances for general purpose thread Class 3G or 4G of ASME/ANSI B1.5 may be used to determine the limiting dimensions for mating threads.

1.9 Basic Diameters

The maximum major diameter of the external thread is basic and is the nominal size for all classes. The minimum pitch diameter of the internal thread is basic and equal to the basic major diameter minus the basic thread height h. The basic minor diameter is the minimum minor diameter of the internal thread. It is equal to the basic major diameter minus twice the basic thread height 2h.

1.10 Length of Engagement

The tolerances specified herein are applicable to lengths of engagement not exceeding twice the nominal major diameter.

1.11 Tolerances

The tolerances on diameters of internal threads are plus, being applied from the minimum sizes to above the minimum sizes. The tolerances on diameters of external threads are minus, being applied from the maximum sizes to below the maximum sizes. The tolerances on the major and minor diameters of external and internal threads are based upon the data in Table 1.

The pitch diameter tolerances for an external or internal thread are the same (see Table 6). Pitch diameter tolerance includes the effects of all variations in thread form and profile including lead (helix), flank angle, taper, and roundness. When gaged with GO/NOT GO gaging in accordance with this Standard, the functional diameter/size is controlled within these limits over the standard GO gage length. Product pitch diameter size, lead (helix), flank angle, taper, and roundness per the above are not individually controlled.

TABLE 1 TOLERANCES ON MAJOR AND MINOR DIAMETERS OF EXTERNAL AND INTERNAL THREADS

•	Diameter erance	Minor Dia Tolera		
External Thread	Internal Thread	External Thread	Internal Thread 4	
1	2	3		
0.05 <i>p</i>	1.0 × pitch diameter tolerance (1)	1.0 × pitch diameter tolerance (1)	0.05 <i>p</i>	

NOTE:

 Pitch diameter tolerances for various practicable combinations of diameter and pitch are given in Table 6.

1.12 Allowances (Minimum Clearances)

Allowances applied to the pitch diameter of the external thread are based on the major diameter and are given in Table 5.

When the product has a length of engagement greater than the standard length of the thread gage as shown in Table 10, column 3, and lead variations not exceeding values shown in the notes to that table, and when GO thread gages of these lengths are to be used, the maximum pitch diameter of the external thread shall be decreased by the amount shown in Table 10, column 5. If the lead variations in the product are greater than indicated, the allowance for the gage stated in column 5 should be increased proportionally. However, if methods of gaging the external thread that will detect angle variation and cumulative lead variation are used, the pitch diameter of the thread shall be below the tabular maximum pitch diameter by an amount sufficient to compensate for the measured variations.

An increase of 10% in the allowance is recommended for each inch, or fraction thereof, that the length of engagement exceeds two diameters.

1.13 Limiting Dimensions


Limiting dimensions for Stub Acme threads of the preferred series of diameters and pitches are given in Table 7. The application of these limits is illustrated in Fig. 2.

STUB ACME SCREW THREADS ASME/ANSI B1.8-1988


1.14 Thread Designations

The following designations are recommended for use on drawings and in specifications, and on tools and gages; right-hand threads are assumed unless LH is specified.

Example

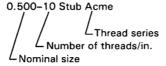

Example

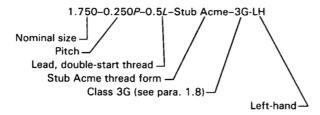

2 GAGES FOR STUB ACME SCREW THREADS

SPECIAL NOTE:

Work is in progress to write an ASME/ANSI B1 standard for screw thread gaging systems suitable for determining the acceptability of Acme/Stub Acme screw threads on external and internal threaded products. The draft of ASME B1.24, Gages and Gaging for General Purpose Acme, Centralizing Acme, and Stub Acme Threads, uses the guidelines as noted in ANSI/ASME B1.3M, which have been established for uniform inch and metric screw threads.

This standard will establish the criteria for product screw thread acceptance when a specified gaging system is used for both in-process control and final dimensional conformance. The format for this standard will follow that already established by ANSI/ASME B1.3M, Unified Inch and Metric Screw Threads.

A screw thread gaging system for external/internal Acme/Stub Acme screw threads comprises a listing of those screw thread characteristics that must be inspected for each specified system and the gage, gages, or gaging systems which shall be used when inspecting those characteristics.

In the interim, until this standard has been completed and released, the following clarifying statement shall apply.

IT IS TO BE UNDERSTOOD THAT NO PREFERENCE IS GIVEN TO LIMIT TYPE THREADED PLUGS AND RINGS OVER OTHER AVAILABLE ATTRIBUTE TYPE GAGES, SUCH AS THREAD SNAP GAGES, OR VARIABLE TYPE LIMIT AND SIZE INDICATING THREADED GAGES FOR BOTH DIMENSIONAL CONFORMANCE AND IN-PROCESS CONTROL.

Both GO and NOT GO gages, which represent the product limits or adequate gaging instruments for thread elements, are necessary for the proper inspection of Stub Acme threads. The dimensions of GO and NOT GO gages should be in accordance with the following principles:

- (a) the GO gage should check simultaneously as many elements as possible, and a NOT GO gage can effectively check but one element;
- (b) permissible variations in the gages be kept within the extreme product limits.

2.1 Gage Tolerances

Tolerances for the thread elements of GO and NOT GO gages for Stub Acme threads are given in Table 9.

- (a) Tolerances on Pitch Diameter. The pitch diameter tolerances for gages for external and internal threads are given in Table 9, column 2.
- (b) Tolerances on Major and Minor Diameters. The major and minor diameter tolerances for Stub Acme thread gages are given in Table 9, column 3.
- (c) Tolerances on Lead. The variation in lead of all Stub Acme thread gages shall not exceed 0.0003 in. between any two threads not farther apart than 1 in. However, the cumulative variation in lead shall not exceed the following:
- (1) 0.0004 in., for gages with a length over 1 in. to 3 in., inclusive;
- (2) 0.0005 in., for gages with a length over 3 in. to 5 in., inclusive;
- (3) 0.0007 in., for gages with a length over 5 in. to 10 in., inclusive.

For multiple threads, the cumulative tolerance for any length of gage shall be obtained by multiplying by 1.5 the above tolerance applicable to that length.

(d) Tolerances on Angle of Gage Threads. The tolerances on angle of thread, as specified in Table 9, column 4 for the various pitches, are tolerances on one-half of the included angle. This ensures that the bisector of the included angle will be perpendicular to the axis of the thread within proper limits. The

deviation from the true thread form caused by such irregularities as convex or concave flanks of the thread, or slight projections on the thread form, should not exceed the tolerances permitted on the angle of thread.

2.1.1 Gages for External Threads

- (a) GO Thread Ring, Thread Snap, or Indicating Gage
- (1) Major Diameter. The major diameter of the GO thread ring, thread snap, or indicating gage shall clear a diameter greater than the maximum major diameter of the external thread by 0.01 in.
- (2) Pitch Diameter. The size of a GO thread gage is determined by its fit or setting on the maximum-material-limit thread setting plug gage.
- (3) Minor Diameter. The minor diameter shall be the same as the maximum minor diameter of the external thread plus 0.005 in. for pitches finer than 10 threads/in., and plus 0.010 in. for 10 threads/in. and coarser. The tolerance shall be minus.
- (4) Length. The length shall approximate the length of engagement, but shall not exceed the length specified in Table 10, column 3.
- (b) Maximum-Material-Limit Thread Setting Plug for GO Thread Ring, Thread Snap, or Indicating Gages
- (1) Major Diameter. The major diameter of the maximum-material-limit thread setting plug shall be the same as the maximum major diameter of the external thread. The gage tolerance shall be plus.
- (2) Pitch Diameter. The pitch diameter shall be the same as the maximum pitch diameter of the external thread, except when modified in accordance with Table 10. The tolerance shall be minus.
- (3) Minor Diameter. The minor diameter shall be cleared below the minimum minor diameter of the GO thread ring, thread snap, or indicating gage.
- (4) Length. The length should approximate the length of the GO gage. See ASME/ANSI B47.1.
- (c) NOT GO Thread Ring, Thread Snap, or Indicating Gage
- (1) Major Diameter. The major diameter of the NOT GO thread ring, thread snap, or indicating gage shall clear a diameter greater than the maximum major diameter of the external thread by 0.010 in.
- (2) Pitch Diameter. The size of a NOT GO thread gage shall be determined by its fit or setting on the minimum-material-limit thread setting plug gage.
- (3) Minor Diameter. The minor diameter shall be the basic minor diameter of the internal thread plus 0.15p with tolerance plus. If this results in a minor diameter greater than the gage P.D. size, the gage

- P.D. size shall be used for the minor diameter with the tolerance minus.
- (4) Length. The length shall approximate three pitches except that, for multiple threads, the length shall provide at least one full turn of thread (see para. 2.1.4).
- (d) Minimum-Material Thread Setting Plug for NOT GO Thread Gage
- (1) Major Diameter. The major diameter of the minimum-material-limit thread setting plug shall be the same as the maximum major diameter of the external thread. The gage tolerance shall be plus.
- (2) Pitch Diameter. The pitch diameter shall be the same as the minimum pitch diameter of the external thread with the tolerance plus.
- (3) Minor Diameter. The minor diameter shall be cleared below the minimum minor diameter of the NOT GO thread gage.
- (4) Length. The length shall be at least equal to the length of the NOT GO thread gage (see ASME/ANSI B47.1).
- (e) GO Plain Ring, Snap, or Indicating Gage for Major Diameter. The diameter of the GO plain ring gage or the gaging dimension of the GO plain snap gage shall be the same as the maximum major diameter of the external thread. Tolerances are shown in Table 8 and shall be minus.
- (f) NOT GO Plain Ring, Snap, or Indicating Gage for Major Diameter. The gaging dimension of the NOT GO plain snap gage shall be the same as the minimum major diameter of the external thread. Tolerances are shown in Table 8 and shall be plus.

2.1.2 Gages for Internal Thread

- (a) GO Thread Plug or Indicating Gage
- (1) Major Diameter. The major diameter of the GO thread plug gage or indicating gage shall be equal to the minimum major diameter of the internal thread minus 0.005 in. for pitches finer than 10 threads/in., and minus 0.010 in. for 10 threads/in. and coarser. The tolerance shall be plus.
- (2) Pitch Diameter. The pitch diameter shall be equal to the minimum (basic) pitch diameter of the internal thread with the tolerance plus.
- (3) Minor Diameter. The minor diameter shall clear a diameter smaller than the minimum minor diameter of the internal thread by 0.010 in.
- (4) Length. The length shall approximate the length of engagement (see notes to Table 10) but shall not exceed twice the nominal major diameter unless otherwise specified.

STUB ACME SCREW THREADS ASME/ANSI B1.8-1988

(b) NOT GO Thread Plug or Indicating Gage

- (1) Major Diameter. The major diameter of the NOT GO thread plug gage or indicating gage shall be equal to the maximum (basic) major diameter of the external thread minus 0.15p with the tolerance minus. If this results in a major diameter smaller than the gage P.D. size, the gage P.D. size shall be used for the major diameter with the gage tolerance plus.
- (2) Pitch Diameter. The pitch diameter shall be the same as the maximum pitch diameter of the internal thread with the tolerance minus.
- (3) Minor Diameter. The minor diameter shall clear a diameter less than the minimum minor diameter of the internal thread by 0.01 in.
- (4) Length. The length should approximate three pitches except that, for multiple threads, the length shall provide at least one full turn of thread (see para. 2.1.4).
- (c) GO Plain Plug or Indicating Gage for Minor Diameter of Internal Thread. The diameter of the GO plain plug gage shall be the same as the minimum minor diameter of the internal thread. The gage tolerance shall be plus (see Table 8). The gage shall be in accordance with ASME/ANSI B47.1.
- (d) NOT GO Plain Plug or Indicating Gage for Minor Diameter of Internal Thread. The diameter of the NOT GO plain plug gage shall be the same as the maximum minor diameter of the internal thread. The gage tolerance shall be minus (see Table 8). The gage length shall be in accordance with ASME/ANSI B47.1.
- **2.1.3 Runout.** When a special check of the runout between the major, pitch, and minor diameters of an

external or internal thread is required, the method of checking this characteristic must be determined regardless of feature size for each individual application (see ANSI Y14.5M).

- **2.1.4 Gage Dimensions.** It is recommended that wherever possible the general dimensions of the gages be in accordance with ASME/ANSI B47.1.
- **2.1.5 Other Gaging.** Section 2 outlines the usage of GO and NOT GO thread plugs and thread ring or thread snap or indicating gages and their associated setting thread plug gages. It also covers the usage of plain plug gages for checking the minor diameter of internal threaded product.

While these types of limit gages are generally used to ensure assembleability of product, they may not provide enough information to ensure that all of the elements of the mating threaded products conform to the tabulated limits of size, etc.

When complete details of thread elements are required, it will be necessary to use other commercially available types of gaging or inspection equipment to obtain this data.

2.1.6 Wire Measurement of Stub Acme Threads.

Refer to Appendix B for details of wire sizes and measurement of 29 deg. included angle threads. Because of the shallow depth of Stub Acme threads, it may be necessary to grind a flat on measuring wires to clear the root of the threads when best size wires are used.

Copyrighted material licensed to Stanford University by Thomson Scientific (www.techstreet.com), downloaded on Oct-05-2010 by Stanford University User. No further reproduction or distribution is permitted. Uncontrolled w

TABLE 2 STUB ACME SCREW THREAD FORM, DESIGN DIMENSIONS

					Width	of Flat
Threads/in.	Pitch P	Height of Thread (Basic) h = 0.3p	Total Height of Thread h _s = h + 1/2 Allowance (1)	Thread Thickness (Basic) t = p/2	Crest of Internal Thread (Basic) F _{cn} = 0.4224p	Root of Internal Thread F _{rn} = 0.4224p · 0.259 × Allowance (1)
1	2	3	4	5	6	7
16	0.06250	0.01875	0.0238	0.03125	0.0264	0.0238
14	0.07143	0.02143	0.0264	0.03571	0.0302	0.0276
12	0.08333	0.02500	0.0300	0.04167	0.0352	0.0326
10	0.10000	0.03000	0.0400	0.05000	0.0422	0.0370
9	0.11111	0.03333	0.0433	0.05556	0.0469	0.0417
8 .	0.12500	0.03750	0.0475	0.06250	0.0528	0.0476
7	0.14268	0.04285	0.0529	0.07143	0.0603	0.0551
6	0.16667	0.05000	0.0600	0.08333	0.0704	0.0652
5	0.20000	0.06000	0.0700	0.10000	0.0845	0.0793
4	0.25000	0.07500	0.0850	0.12500	0.1056	0.1004
31/2	0.28571	0.08571	0.0957	0.14286	0.1207	0.1155
3	0.33333	0.10000	0.1100	0.16667	0.1408	0.1356
21/2	0.40000	0.12000	0.1300	0.20000	0.1690	0.1638
2	0.50000	0.15000	0.1600	0.25000	0.2112	0.2060
1 1/2	0.66667	0.20000	0.2100	0.33333	0.2816	0.2764
1 1/3	0.75000	0.22500	0.2350	0.37500	0.3168	0.3116
1	1.00000	0.30000	0.3100	0.50000	0.4224	0.4172

NOTE

⁽¹⁾ Allowance shown in Table 4, column 3.

STUB ACME SCREW THREADS ASME/ANSI B1.8-1988

TABLE 3 STUB ACME SCREW THREADS, STANDARD SERIES, BASIC DIMENSIONS

			'	Basic Diamete	ers			Thread Data			
Nomina	ıl Sizes	Threads/in.	Major Diameter <i>D</i>	Pitch Diameter D ₂ = D - h	Minor Diameter D ₁ = D - 2h	Pitch	Thread Thickness at Pitch Line $t = p/2$	Basic Thread Height h = 0.3p	Basic Width of Flat F 0.4224p	at E Pi Diar	Angle Basic tch neter λ
1		2	3	4	5	6	7	8	9	<u> </u>	10
				-	3	•	/	•	, ,	'	
0.2500	1/4	16	0.2500	0.2312	0.2125	0.06250	0.03125	0.01875	0.0264	4	54
0.3125	5/16	14	0.3125	0.2911	0.2696	0.07143	0.03572	0.02143	0.0302	4	28
0.3750	3/8	12	0.3750	0.3500	0.3250	0.08333	0.04167	0.02500	0.0352	4	20
0.4375	7/16	12	0.4375	0.4125	0.3875	0.08333	0.04167	0.02500	0.0352	3	41
0.5000	1/2	10	0.5000	0.4700	0.4400	0.10000	0.05000	0.03000	0.0422	3	52
0.6250	5/8	8	0.6250	0.5875	0.5500	0.12500	0.06250	0.03750	0.0528	3	52
0.7500	3/4	6	0.7500	0.7000	0.6500	0.16667	0.08333	0.05000	0.0704	4	20
0.8750	7/8	6	0.8750	0.8250	0.7750	0.16667	0.08333	0.05000	0.0704	3	41
1.0000	1	5	1.0000	0.9400	0.8800	0.20000	0.10000	0.06000	0.0845	3	52
1.1250	1 1/8	5	1.1250	1.0650	1.0050	0.20000	0.10000	0.06000	0.0845	3	25
1.2500	1 1/4	5	1.2500	1.1900	1.1300	0.20000	0.10000	0.06000	0.0845	3	4
1.3750	1 3/8	4	1.3750	1.3000	1.2250	0.25000	0.12500	0.07500	0.1056	3	30
1.5000	1 1/2	4	1.5000	1.4250	1.3500	0.25000	0.12500	0.07500	0.1056	3	12
1.7500	13/4	4	1.7500	1.6750	1.6000	0.25000	0.12500	0.07500	0.1056	2	43
2.0000	2	4	2.0000	1.9250	1.8500	0.25000	0.12500	0.07500	0.1056	2	22
2.2500	21/4	3	2.2500	2.1500	2.0500	0.33333	0.16667	0.10000	0.1408	2	50
2.5000	21/2	3	2.5000	2.4000	2.3000	0.33333	0.16667	0.10000	0.1408	2	32
2.7500	23/4	3	2.7500	2.6500	2.5500	0.33333	0.16667	0.10000	0.1408	2	18
3.0000	3	2	3.0000	2.8500	2.7000	0.50000	0.25000	0.15000	0.2112	3	12
3.5000	31/2	2	3.5000	3.3500	3.2000	0.50000	0.25000	0.15000	0.2112	2	43
4.0000	4	2	4.0000	3.8500	3.7000	0.50000	0.25000	0.15000	0.2112	2	22
4.5000	41/2	2	4.5000	4.3500	4.2000	0.50000	0.25000	0.15000	0.2112	2	6
5.0000	5	2	5.0000	4.8500	4.7000	0.50000	0.25000	0.15000	0.2112	1	53

TABLE 4 TOLERANCES AND ALLOWANCES FOR MAJOR AND MINOR DIAMETERS, STUB ACME SCREW THREADS, STANDARD SERIES

			Basic M	ces From lajor and iameters	Tolerance on Minor	Tolerance on Major	Tolerance (1) on Major Diameter All Internal
Size	e	Threads/in.	Major (2) Diameter All Internal Threads (Plus)	Minor (3) Diameter All External Threads (Minus)	Diameter All Internal Threads (Plus) 0.05p	Diameter All External Threads (Minus) 0.05p	Threads (Plus) and Minor Diameter All External Threads (Minus)
1		2	3	4	5	6	7
0.2500	1/4	16	0.010	0.010	0.0031	0.0031	0.0105
0.3125	5/16	14	0.010	0.010	0.0036	0.0036	0.0114
0.3750	3/8	12	0.010	0.010	0.0042	0.0042	0.0123
0.4375	7/16	12	0.010	0.010	0.0042	0.0042	0.0126
0.5000	1/2	10	0.020	0.020	0.0050	0.0050	0.0137
0.6250	5/8	8	0.020	0.020	0.0062	0.0062	0.0154
0.7500	3/4	6	0.020	0.020	0.0083	0.0083	0.0174
0.8750	7/8	6	0.020	0.020	0.0083	0.0083	0.0179
1.0000	1	5	0.020	0.020	0.0100	0.0100	0.0194
1.1250	1 ½	5	0.020	0.020	0.0100	0.0100	0.0198
1.2500	1 1/4	5	0.020	0.020	0.0100	0.0100	0.0201
1.3750	13/8	4	0.020	0.020	0.0125	0.0125	0.0220
1.5000	1 1/2	4	0.020	0.020	0.0125	0.0125	0.0223
1.7500	13/4	4	0.020	0.020	0.0125	0.0125	0.0229
2.0000	2	4	0.020	0.020	0.0125	0.0125	0.0235
2.2500	21/4	3	0.020	0.020	0.0167	0.0167	0.0263
2.5000	21/2	3	0.020	0.020	0.0167	0.0167	0.0268
2.7500	23/4	3	0.020	0.020	0.0167	0.0167	0.0273
3.0000	3	2	0.020	0.020	0.0250	0.0250	0.0316
3.5000	31/2	2	0.020	0.020	0.0250	0.0250	0.0324
4.0000	4	2	0.020	0.020	0.0250	0.0250	0.0332
	41/2	2	0.020	0.020	0.0250	0.0250	0.0339
5.0000	5	2	0.020	0.020	0.0250	0.0250	0.0346

GENERAL NOTE:

Pitch diameter tolerances for various practicable combinations of diameter and pitch are given in Table 6.

NOTES

(1) The values in this column were developed by the following formula:

2G tolerance = pitch increment $(0.030\sqrt{1/n})$ + diameter increment $(0.006\sqrt{D})$

This formula reduces to

$$0.006 \left(\sqrt{D} + 5\sqrt{\rho} \right)$$

These values equal the P.D. tolerance.

⁽²⁾ The minimum clearance at the major diameter between the internal and external threads is equal to values in column 3.

⁽³⁾ The minimum clearance at the minor diameter between the internal and external threads is equal to the values in column 4.

Copyrighted material licensed to Stanford University by Thomson Scientific (www.techstreet.com), downloaded on Oct-05-2010 by Stanford University User. No further reproduction or distribution is permitted. Uncontrolled

TABLE 5 PITCH DIAMETER ALLOWANCES FOR STUB ACME SCREW THREADS

Nomi	nal Size Range	Allowances on External Threads (1)
Above	To and Including	$0.008\sqrt{D}$
1	2	3
0	0.1875	0.0024
0.1875	0.3125	0.0040
0.3125	0.4375	0.0049
0.4375	0.5625	0.0057
0.5625	0.6875	0.0063
0.6875	0.8125	0.0069
0.8125	0.9375	0.0075
0.9375	1.0625	0.0080
1.0625	1.1875	0.0085
1.1875	1.3125	0.0089
1.3125	1.4375	0.0094
1.4375	1.5625	0.0098
1.5625	1.8750	0.0105
1.8750	2.1250	0.0113
2.1250	2.3750	0.0120
2.3750	2.6250	0.0126
2.6250	2.8750	0.0133
2.8750	3.2500	0.0140
3.2500	3.7500	0.0150
3.7500	4.2500	0.0160
4.2500	4.7500	0.0170
4.7500	5.5000	0.0181

NOTE

⁽¹⁾ The values in this column are to be used for any nominal size within the range shown in columns 1 and 2. These values are calculated from the mean of the range. It is recommended that the nominal sizes given in Table 3 be used whenever possible.

TABLE 6 PITCH DIAMETER TOLERANCES FOR STUB ACME SCREW THREADS

Threads/in.	Pitch Increment				Nominal Di	ameter (1)			
nreads/in.	0.030 √1/n	1/4	5/16	3/8	7/16	1/2	5/8	3/4	7/8
16	0.00750	0.0105	0.0109	0.0112	0.0115	0.0117	0.0122	0.0127	
14	0.00802		0.0114	0.0117	0.0120	0.0123	0.0128	0.0132	0.0136
12	0.00866			0.0123	0.0126	0.0129	0.0134	0.0139	0.0143
10	0.00949			0.0132	0.0135	0.0137	0.0142	0.0147	0.0151
8	0.01061					0.0148	0.0154	0.0158	0.0162
6	0.01225							0.0174	0.0179
5	0.01342								0.0190
Diameter Incremose 0.006 \sqrt{D}	nent	0.00300	0.00335	0.00367	0.00397	0.00424	0.00474	0.00520	0.0056
Thursdo fin	Pitch				Nominal D	iameter (1)			
Threads/in. <i>n</i>	Increment $0.030\sqrt{1/n}$	1	11/8	11/4	13/8	11/2	13/4	2	21/4
14	0.00802	0.0140							
12	0.00866	0.0147	0.0150	0.0154					
10	0.00949	0.0155	0.0158	0.0162	0.0165	0.0168	0.0174		
8	0.01061	0.0166	0.0170	0.0173	0.0176	0.0180	0.0185	0.0191	
6	0.01225	0.0182	0.0186	0.0190	0.0193	0.0196	0.0202	0.0207	0.0212
5	0.01342	0.0194	0.0198	0.0201	0.0205	0.0208	0.0214	0.0219	0.0224
4	0.01500		0.0214	0.0217	0.0220	0.0223	0.0229	0.0235	0.0240
3	0.01732					0.0247	0.0253	0.0258	0.0263
· 21/2	0.01897						0.0269	0.0275	0.0280
2	0.02121							0.0297	0.0302
Diameter Increment		0.00000	0.00000	0.00071	0.00704	0.00735	0.00704	0.00840	0.0000
0.006√D -		0.00600	0.00636	0.00671	0.00704	0.00735	0.00794	0.00849	0.00900
Threads/in.	Pitch Increment				Nominal D	iameter (1)			
n	$0.030\sqrt{1/n}$	21/2	23/4	3	31/2	4	41/2	5	
5	0.01342	0.0229							
4	0.01500	0.0245	0.0249	0.0254	0.0262	0.0270			
3	0.01732	0.0268	0.0273	0.0277	0.0285	0.0293	0.0300	0.0307	
21/2	0.01897	0.0285	0.0289	0.0294	0.0302	0.0310	0.0317	0.0324	İ
2	0.02121	0.0307	0.0312	0.0316	0.0324	0.0332	0.0339	0.0346	
1 1/2	0.02449			0.0349	0.0357	0.0365	0.0372	0.0379	
1 1/3	0.02598			0.0364	0.0372	0.0380	0.0387	0.0394	
1	0.03000				0.0412	0.0420	0.0427	0.0434	
Diameter In <u>cr</u> en	nent								
0.006 √D −		0.00949	0.00995	0.01039	0.01122	0.01200	0.01273	0.01342	

GENERAL NOTES:

NOTE

⁽a) The equivalent tolerance on thread thickness is 0.259 times the pitch diameter tolerance.

⁽b) The pitch diameter tolerances shown in this Table equal the sum of the pitch increment in the second column and the diameter increment in the last line, which reduces to 0.006 $(\sqrt{D} + 5\sqrt{p})$.

⁽¹⁾ For an intermediate nominal diameter, apply the pitch diameter tolerance for the next larger nominal diameter given in this Table.

TABLE 7 LIMITING DIMENSIONS AND TOLERANCES, STUB ACME SCREW THREADS, STANDARD SERIES

							Nominal Diameter D	iameter D					
		1/4	5/16	3/8	7/16	1/2	8/8	3/4	7/8	1	11/8	11/4	13/8
osotomoi C scitimi I	940						Threads/in.	ds/in.					
and Tolerances	rances	16	14	12	12	10	8	9	9	5	5	5	4
External Threads	s												
Major Diam.	Max. D Min. Tol.	0.2500 0.2469 0.0031	0.3089 0.0036	0.3750 0.3708 0.0042	0.4375 0.4333 0.0042	0.5000 0.4950 0.0050	0.6250 0.6188 0.0062	0.7500 0.7417 0.0083	0.8750 0.8667 0.0083	0.9900	1.1250 1.1150 0.0100	1.2500 1.2400 0.0100	1.3750 1.3625 0.0125
Pitch Diam.	Max. Min.	0.2272 0.2167 0.0105	0.2871 0.2757 0.0114	0.3451 0.3328 0.0123	0.4076 0.3950 0.0126	0.4643 0.4506 0.0137	0.5812 0.5658 0.0154	0.6931 0.6757 0.0174	0.8175 0.7996 0.0179	0.9320 0.9126 0.0194	1.0565 1.0367 0.0198	1.1811	1.2906 1.2686 0.0220
Minor Diam.	Max. Min. Tol.	0.2024 0.1919 0.0105	0.2597 0.2483 0.0114	0.3150 0.3027 0.0123	0.3775 0.3649 0.0126	0.4200 0.4063 0.0137	0.5300 0.5146 0.0154	0.6300 0.6126 0.0174	0.7550 0.7371 0.0179	0.8600 0.8406 0.0194	0.9850 0.9652 0.0198	1.1100 1.0899 0.0201	1.2050 1.1830 0.0220
Internal Threads													
Major Diam.	Min. Max. Tol.	0.2600 0.2705 0.0105	0.3225 0.3339 0.0114	0.3850 0.3973 0.0123	0.4475 0.4601 0.0126	0.5200 0.5337 0.0137	0.6450 0.6604 0.0154	0.7700 0.7874 0.0174	0.8950 0.9129 0.0179	1.0200 1.0394 0.0194	1.1450 1.1648 0.0198	1.2700 1.2901 0.0201	1.3950 1.4170 0.0220
Pitch Diam.	Min. Max. Tol.	0.2312 0.2417 0.0105	0.2911 0.3025 0.0114	0.3500 0.3623 0.0123	0.4125 0.4251 0.0126	0.4700 0.4837 0.0137	0.5875 0.6029 0.0154	0.7000 0.7174 0.0174	0.8250 0.8429 0.0179	0.9400 0.9594 0.0194	1.0650 1.0848 0.0198	1.1900	1.3000 1.3220 0.0220
Minor Diam.	Min. Max. Tol.	0.2125 0.2156 0.0031	0.2696 0.2732 0.0036	0.3250 0.3292 0.0042	0.3875 0.3917 0.0042	0.4400 0.4450 0.0050	0.5500 0.5562 0.0062	0.6500 0.6583 0.0083	0.7750 0.7833 0.0083	0.8800 0.8900 0.0100	1.0050 1.0150 0.0100	1.1300 1.1400 0.0100	1.2250 1.2375 0.0125

TABLE 7 LIMITING DIMENSIONS AND TOLERANCES, STUB ACME SCREW THREADS, STANDARD SERIES (CONT'D)

And the state of t	other in wife sum to constrain	The state of the s				Nominal C	Nominal Diameter D					
	'	11/2	13/4	2	21/4	21/2	23/4	က	31/2	4	41/2	2
i imitina Dismoteve	motore					Thre	Threads/in.					
and Tolerances	rances	4	4	4	3	3	ဧ	2	2	2	2	2
External Threads	S		7744									
a ciclo	Max. D	1.5000	1.7500	2.0000	2.2500	2.5000	2.7500	3.0000	3.5000	4.0000	4.5000	5.0000
Major Diain.	Tol.	0.0125	0.0125	0.0125	0.0167	0.0167	0.0167	0.0250	3.4750	3.9750 0.0250	0.0250	4.9750 0.0250
Ditch Diam	Max.	1.4152	1.6645	1.9137	2.1380	2.3874	2.6367	2.8360	3.3350	3.8340	4.3330	4.8319
	Tol.	0.0223	0.0229	0.0235	0.0263	0.0268	0.0273	0.0316	0.0324	0.0332	0.0339	4.7973 0.0346
Major Diam.	Max. Min.	1.3300	1.5800	1.8300	2.0300	2.2800	2.5300	2.6800	3.1800	3.6800	4.1800	4.6800 4.6454
	Tol.	0.0223	0.0229	0.0235	0.0263	0.0268	0.0273	0.0316	0.0324	0.0332	0.0339	0.0346
Internal Threads												
·	Min.	1.5200	1.7700	2.0200	2.2700	2.5200	2.7700	3.0200	3.5200	4.0200	4.5200	5.0200
Major Diam.	Max.	0.0223	0.0229	2.0435 0.0235	2.2963 0.0263	2.5468 0.0268	2./9/3 0.0273	3.0516 0.0316	3.5524 0.0324	4.0532 0.0332	4.5539 0.0339	5.0546 0.0346
į	Min.	1.4250	1.6750	1.9250	2.1500	2.4000	2.6500	2.8500	3.3500	3.8500	4.3500	4.8500
Pitch Diam.	Max. Tol.	0.0223	1.6979 0.0229	1.9485 0.0235	2.1763 0.0263	2.4268 0.0268	2.6773 0.0273	2.8816 0.0316	3.3824	3.8832 0.0332	4.3839 0.0339	4.8846 0.0346
	Min.	1.3500	1.6000	1.8500	2.0500	2.3000	2.5500	2.7000	3.2000	3.7000	4.2000	4.7000
Minor Diam.	Max. Tol.	1.3625 0.0125	1.6125 0.0125	1.8625 0.0125	2.0667 0.0167	2.3167 0.0167	2.5667 0.0167	2.7250 0.0250	3.2250	3.7250 0.0250	4.2250 0.0250	4.7250 0.0250

STUB ACME SCREW THREADS ASME/ANSI B1.8-1988

TABLE 8 PLAIN GAGE TOLERANCES

Size	Range			
Above	To and Including	Tolerances for Plain Gages		
1	2	3		
0.500	0.825	0.00010		
0.825	1.510	0.00012		
1.510	2.510	0.00016		
2.510	4.510	0.00020		
4.510	5.000	0.00025		

TABLE 9 TOLERANCES FOR GO AND NOT GO THREAD WORKING AND SETTING GAGES, STUB ACME SCREW THREADS

	Tolerances on Pitch	Tolerance on Major and Minor	Half A	nce on Angle of ead
Threads/in.	Diameters (1)	Diameters	deg.	min
, 1	2	3		1
16	0.0006	0.001	0	10
14	0.0006	0.001	0	10
12	0.0006	0.001	0	10
10	0.0007	0.002	0	10
9	0.0008	0.002	0	10
8	0.0008	0.002	0	8
7	0.0009	0.002	0	8
6	0.0009	0.002	0	8
5	0.0010	0.002	0	8
4	0.0011	0.002	0	8
31/2	0.0013	0.002	0	8
3	0.0013	0.002	0	6
21/2	0.0014	0.002	О	6
2	0.0015	0.002	0	6
1 1/2	0.0018	0.002	0	5
1 1/3	0.0018	0.002	0	5
1	0.0021	0.002	0	5

GENERAL NOTE:

Intermediate pitches take the tolerance of the next coarser pitch listed in this Table.

NOTE

(1) These pitch diameter tolerances for thread gages are not cumulative, that is, they do not include tolerances on lead and half-angle.

TABLE 10 PITCH DIAMETER COMPENSATION FOR ADJUSTED LENGTHS OF GO RING GAGES

Nominal Major Diameter of External Thread				Maximum Amount Pitch Diameter of GO Ring Shall Be Less Than Maximum Pitch (2) Diameter External	
Above	To and Including	in. (1)	Length of Gage	Thread	
1	2	3	4	5	
0	1.000	2 diameters	0	0	
1.000	1.125	2.000	0.250	0.0012	
1.125	1.250	2.000	0.500	0.0012	
1.250	1.375	2.000	0.750	0.0015	
1.375	1.500	2.000	1.000	0.0015	
1.500	1.750	2.000	1.500	0.0015	
1.750	2.000	2.000	2.000	0.0019	
2.000	2.250	2.500	2.000	0.0019	
2.250	2.500	2.500	2.500	0.0019	
2.500	2.750	2.500	3.000	0.0019	
2.750	3.000	3.000	3.000	0.0019	
3.000	4.000	3.000	5.000	0.0027	
4.000	5.000	3.000	7.000	0.0039	

GENERAL NOTE:

Unless otherwise indicated, dimensions are in inches.

NOTES

(1) This compensation is based on a length of engagement not exceeding two diameters and a lead variation in the product not exceeding the following, in inches:

0.0003 in length of 1/2 in. or less

0.0004 in length over 1/2 in. - 11/2 in.

0.0005 in length over 11/2 in. - 3 in.

0.0007 in length over 3 in. - 6 in.

0.0010 in length over 6 in. - 10 in.

- (a) The principles have been established in the requirements of this Table that GO gages should approximate the length of engagement and NOT GO gages should be three pitches long. For reasons of economy or limitations in gage manufacture or use, it may be desirable to modify these principles as follows:
 - (1) take advantage of the economies of using standard blanks, as listed in ASME/ANSI B47.1, wherever they may be utilized successfully;
 - (2) avoid too cumbersome ring gages, as well as excessively expensive gages, by limiting the length of GO thread ring gages to maximum lengths given in column 3 of this Table;
 - (3) avoid excessively cumbersome thread plug gages by limiting maximum length to two diameters wherever possible;
 - (4) take full advantage of modern equipment for producing and checking accurate leads, particularly where long engagements are involved, thus permitting the use of standard or moderate length thread plug, thread ring, or thread snap gages. Alternatively, of course, instruments may be used for checking diameters and angles independently.
- (b) Should a GO gage shorter than the length of engagement be chosen, independent means should be used to measure lead variation in the product. If the lead variation Δp in the length of engagement LE, so determined, exceeds 0.259es (where es is the product pitch diameter allowance), the maximum metal condition must be reduced to ensure free assembly of product. The required amount of change in pitch diameter Δd_2 of the product (minus on external thread, plus on internal thread) accordingly, is:

$$\Delta d_2 = 3.867 \left(1 - LG/LE \right) \Delta p$$

where

LG = gage length

LE = engagement length

- (c) When instruments are used for checking diameter, it is a simple matter to make this allowance. When thread plug and ring gages are used, the allowance is sometimes increased by a fixed amount, as outlined in this Table. This arbitrarily changes the tolerance on pitch diameter.
- (2) See para. 2.1.1(a)(4).

APPENDIX A

ALTERNATIVE STUB ACME THREADS, MODIFIED FORM 1 AND MODIFIED FORM 2

(This Appendix is not part of ASME/ANSI B1.8-1988, and is included for information purposes only.)

Recognizing the fact that one Stub Acme thread form may not provide a generally acceptable thread system to meet the requirements of all applications, basic data for two of the other commonly used forms (shown in Figs. A1 and A2) are tabulated in Tables A1 and A2. Wherever practicable, the standard Stub Acme thread form should be used.

In applying the foregoing data to special designs, the allowances and tolerances can be taken directly from Tables 4, 5, and 6 for standard Stub Acme threads. Therefore, the major diameter and basic thread thickness at pitch line for both external and internal threads will be the same as for the standard form, as shown in Tables 3 and 7. The pitch diameter and minor diameter will vary from the data shown in Tables 3 and 7. For the Modified Form 1 Stub Acme

thread, the pitch and minor diameters will be smaller than similar values for the standard form; and for Modified Form 2 the pitch and minor diameters will be larger than those dimensions for the standard forms.

For gaging these modified Stub Acme threads, the principles of gaging outlined in Section 2 (para. 2.1.3) of this Standard will apply.

The dimensions of gages can be calculated from the data in Section 2 (paras. 2.1.1, 2.1.2, and 2.1.4).

The gage tolerances should be taken from para. 2.1 and Tables 8, 9, and 10.

These threads should be designated on drawings as described in para. 1.14 with the insertion after "Acme" of "M1" for the Modified Form 1 and "M2" for the Modified Form 2.

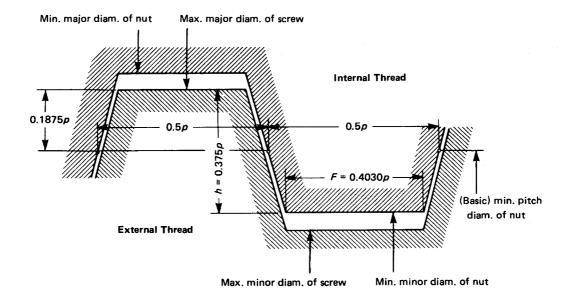


FIG. A1 MODIFIED STUB ACME THREAD WITH BASIC HEIGHT OF 0.375p (FORM 1)

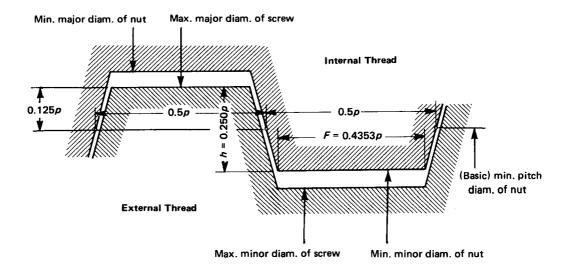


FIG. A2 MODIFIED STUB ACME THREAD WITH BASIC HEIGHT OF 0.250p (FORM 2)

TABLE A1 MODIFIED STUB ACME THREAD FORM, DESIGN DIMENSIONS (FORM 1)

Threads/in.	Pitch <i>p</i>	Height of Thread (Basic) h = 0.375p	Total Height of Thread $h_S = h +$ 1/2 Allowance (1)	Thread Thickness (Basic) $t = \rho/2$	Width of Flat at Crest of Internal Thread (Basic) F = 0.4030p
1	2	3	4	5	6
16	0.06250	0.02344	0.0284	0.03125	0.0252
14	0.07143	0.02679	0.0318	0.03572	0.0288
12	0.08333	0.03125	0.0363	0.04167	0.0336
10	0.10000	0.03750	0.0475	0.05000	0.0403
9	0.11111	0.04167	0.0517	0.05556	0.0448
8	0.12500	0.04688	0.0569	0.06250	0.0504
7	0.14286	0.05357	0.0636	0.07143	0.0576
6	0.16667	0.06250	0.0725	0.08333	0.0672
5	0.20000	0.07500	0.0850	0.10000	0.0806
4	0.25000	0.09375	0.1038	0.12500	0.1008
31/2	0.28571	0.10714	0.1171	0.14286	0.1151
3	0.33333	0.12500	0.1350	0.16667	0.1343
21/2	0.40000	0.15000	0.1600	0.20000	0.1612
2	0.50000	0.18750	0.1975	0.25000	0.2015
1 1/2	0.66667	0.25000	0.2600	0.33333	0.2687
1 ¹/₃	0.75000	0.28125	0.2913	0.37500	0.3023
1	1.00000	0.37500	0.3850	0.50000	0.4030

NOTE: (1) Allowance shown in Table 4, column 3.

TABLE A2 MODIFIED STUB ACME THREAD FORM, DESIGN DIMENSIONS (FORM 2)

Threads/in.	Pitch <i>p</i>	Height of Thread (Basic) h = 0.250p	Total Height of Thread $h_S = h +$ 1/2 Allowance (1)	Thread Thickness (Basic) t = p/2	Width of Flat at Crest of Internal Thread (Basic) F = 0.4353p
1	2	3	4	5	6
16	0.06250	0.01563	0.0206	0.03125	0.0272
14	0.07143	0.01786	0.0229	0.03571	0.0311
12	0.08333	0.02083	0.0258	0.04167	0.0363
10	0.10000	0.02500	0.0350	0.05000	0.0435
9	0.11111	0.02778	0.0378	0.05556	0.0484
8	0.12500	0.03125	0.0413	0.06250	0.0544
7	0.14286	0.03571	0.0457	0.07143	0.0622
6	0.16667	0.04167	0.0517	0.08333	0.0726
5	0.20000	0.05000	0.0600	0.10000	0.0871
4	0.25000	0.06250	0.0725	0.12500	0.1088
31/2	0.28571	0.07143	0.0814	0.14286	0.1244
3	0.33333	0.08333	0.0933	0.16667	0.1451
21/2	0.40000	0.10000	0.1100	0.20000	0.1741
2	0.50000	0.12500	0.1350	0.25000	0.2177
1 1/2	0.66667	0.16667	0.1767	0.33333	0.2902
1 1/3	0.75000	0.18750	0.1975	0.37500	0.3265
1	1.00000	0.25000	0.2600	0.50000	0.4353

NOTE: (1) Allowance shown in Table 4, column 3.

APPENDIX B

THREE-WIRE METHOD OF MEASUREMENT OF PITCH DIAMETER OF 29 deg. STUB ACME THREADS

(This Appendix is not part of ASME/ANSI B1.8-1988, and is included for information purposes only.)

B1 THREAD WIRE SPECIFICATIONS, CALIBRA-TION, AND USE

The computed value for the pitch diameter of a screw thread gage obtained from readings over wires will depend upon the accuracy of the measuring instrument used, the contact load, and the value of the diameter of the wires used in the computations. In order to measure the pitch diameter of a screw thread gage to an accuracy of 0.0001 in. by means of wires, it is necessary to know the wire diameters to 0.00002 in. Accordingly, it is necessary to use a measuring instrument that reads accurately to 0.00001 in.

Variations in diameter around the wire should be determined by rotating the wire between a measuring contact and an anvil having the form of a V-groove cut on a cylinder and having the same flank angles, 14 deg. 30 min, as the thread to be measured. As thus measured, the limit on roundness deviation shall be 0.00005 in.

To avoid a permanent deformation of the material of the wires and gages it is necessary to limit the contact load, and for consistent results a standard practice as to contact load in making wire measurements of hardened screw thread gages is necessary.

In the case of Stub Acme threads, the wire presses against the sides of the thread with a pressure of approximately twice that of the measuring instrument. This would indicate that the diameter of the wires should be measured against a hardened cylinder having a radius equal to the radius of curvature of the helical surface of the thread at the point of contact, using approximately twice the load to be used in making pitch diameter readings. As with 60 deg. threads it is not practical to use such a variety of sizes, and it is recommended that the measurements of wire diameter be made between a flat contact and a 0.750 in. hardened and accurately finished steel cylinder. To limit the tendency of the wires to wedge in and deform the sides of a Stub Acme thread, it is recommended that pitch

diameter measurements on 8 threads/in. and finer be made at 1 lb. For coarser pitches and larger wires the deformation of wires and threads is less than for finer pitches. Furthermore, the coarser pitches are used on larger and heavier products, on which the pitch diameter tolerance is greater and a larger measuring load may be required to make satisfactory measurements. It is, therefore, recommended that for threads/in. coarser than 8, the pitch diameter be measured at 2½ lb.

The standard specification for wires and standard practice in the measurement of 60 deg. wires stated in ANSI/ASME B1.2 are applicable to wires for Stub Acme threads, with the above-stated exceptions as to angle of V-groove and limit on roundness.

B2 FORMULAS FOR MEASURING THE PITCH DIAMETER OF STUB ACME THREADS (29 deg.)

B2.1 Lead Angle

The combination of small flank angle and large lead angle that is characteristic of Stub Acme threads results in a relatively large lead angle correction to be applied in wire measurements of pitch diameter of such threads. In the case of multiple-start threads, the geometry is such that it is no longer feasible to make the usual simplifying assumptions as to the positions of contact of the wire in the thread. Accordingly, measurement of single-start Stub Acme threads (with lead angles less than 5 deg.) is treated similar to the measurement of 60 deg. threads when the value for the term

$$\frac{\omega \tan^2 \lambda \cos \alpha \cot \alpha}{2}$$

is 0.00015 in. or smaller (see ANSI/ASME B1.2). For threads having lead angles greater than 5 deg., the necessary refinements in the calculations are presented.

B2.2 Single-Start External Threads

The general formula is

$$d_2 = M_w + \frac{\cot \alpha}{2n} - w(1 + \csc \alpha') \tag{1}$$

where

 d_2 = pitch diameter

 $M_{\rm w}$ = measurement over wires

 α = half-angle of thread

n = threads/in. = 1/pitch

w = wire diameter

 $\alpha' = \tan^{-1} (\tan \alpha \cos \lambda)$

 λ = lead angle at pitch diameter

For a half-angle of 14 deg. 30 min, Eq. (1) takes the form

$$d_2 = M_w + \frac{1.933\ 357}{n} - w(1 + \csc \alpha') \tag{2}$$

The diameter w of the wires used should be as close as practicable to the size that will contact the flanks of the thread at the pitch line to minimize errors caused by deviations of the flank angle from nominal value. The best-size wire, to be applied only where the lead angle does not exceed approximately 5 deg., may be taken as

$$w_b = \frac{\sec \alpha}{2n} = \frac{0.516\,450}{n} \tag{3}$$

for which values are tabulated in Table B1.

For standard diameter-pitch combinations of Stub Acme threads, and where the best-size wire is used, the computations are simplified by the use of Table B2. Thus

$$d_2 = M_w - \text{column 7} \tag{4}$$

or, if d_2 differs appreciably from the basic value given in column 3

$$d_2 = M_w - \text{column } 7 - 100 \text{ (column } 3 - d_{2_1})$$
× column 8 (5)

TABLE B1 WIRE SIZES AND CONSTANTS, SINGLE-START STUB ACME THREADS (29 deg.)

	Pitch	Wire Sizes (1)					
Threads/in.	$p = \frac{1}{n}$	Best 0.516450 <i>p</i>	Maximum 0.650013 <i>p</i>	Minimum 0.487263 <i>p</i>			
1	2	3	4	5			
	in.	in.	in.	in.			
16	0.06250	0.03228	0.04063	0.03045			
14	0.07143	0.03689	0.04643	0.03480			
12	0.08333	0.04304	0.05417	0.04061			
10	0.10000	0.05164	0.06500	0.04873			
9	0.11111	0.05738	0.07222	0.05414			
8	0.12500	0.06456	0.08125	0.06091			
7	0.14286	0.07378	0.09286	0.06961			
6	0.16667	0.08608	0.10834	0.08121			
5	0.20000	0.10329	0.13000	0.09745			
4	0.25000	0.12911	0.16250	0.12182			
31/2	0.28571	0.14756	0.18572	0.13922			
3	0.33333	0.17215	0.21667	0.16242			
21/2	0.40000	0.20658	0.26001	0.19491			
2	0.50000	0.25822	0.32501	0.24363			
11/2	0.66667	0.34430	0.43334	0.32484			
11/3	0.75000	0.38734	0.48751	0.36545			
1	1.00000	0.51645	0.65001	0.48726			

NOTE:

(1) Based on zero lead angle.

here

$$d_{2_1} = M_w - \text{column } 7$$

If the measured wire diameter w' differs slightly (not more than 0.0003 in.) from the best size w shown in column 4, then

$$d_2 = M_w - \text{column } 7 - 5 (w' - w)$$

- 100 (column 3 - d_{21}) column 8 (6)

However, the correction derived from column 8 is seldom significant in amount for standard diameter-pitch combinations.

Values of the term $(1 + \csc \alpha')$ are given in Table B3 for use when threads of other than standard diameter-pitch combinations are to be measured. Values for intermediate lead angles may be determined by interpolation.

The three-wire measurement of Stub Acme threads corresponds to that of 29 deg. Acme threads. However, because of the shallower root on the Stub Acme

TABLE B2 VALUES FOR WIRE MEASUREMENTS OF SINGLE-START STANDARD STUB ACME THREADS (29 deg.)

Sizes	Threads/in.	Basic Pitch Diameter	Best-Size Wire $w = \frac{0.516450}{n}$	cot 14 deg. 30 min 2 <i>n</i>	w (1 + cosec α')	Column 6 Minus Column 5 (1)	Change in Columns 6 and 7 per 0.01 in. Change in Pitch Diameter (Column 3)
1	2	3	4	5	6	7	8
in.		in.	in.		in.	in.	in.
0.250	16	0.2312	0.03228	0.120835	0.161422	0.040587	0.000044
0.3125	14	0.2911	0.03689	0.138097	0.184647	0.046550	0.000031
0.375	12	0.3500	0.04304	0.161113	0.215407	0.054294	0.000025
0.4375	12	0.4125	0.04304	0.161113	0.215477	0.054364	0.000018
0.500	10	0.4700	0.05164	0.193336	0.258329	0.064993	0.000021
0.625	8	0.5875	0.06456	0.241670	0.322961	0.018291	0.000021
0.750	6	0.7000	0.08608	0.322226	0.430800	0.108574	0.000030
0.875	6	0.8250	0.08608	0.322226	0.430542	0.108316	0.000019
1.000	5	0.9400	0.10329	0.386671	0.516707	0.130036	0.000021
1.125	5	1.0650	0.10329	0.386671	0.516620	0.219949	0.000014
1.250	5	1.1900	0.10329	0.386671	0.516356	0.129685	0.000014
1.375	4	1.3000	0.12911	0.483339	0.645669	0.162330	0.000014
1.500	4	1.4250	0.12911	0.483339	0.645518	0.162179	0.000012
1.750	4	1.6750	0.12911	0.483339	0.645310	0.161971	0.000007
2.000	4	1.9250	0.12911	0.483339	0.645178	0.161839	0.000005
2.250	3	2.1500	0.17215	0.644452	0.860533	0.216081	0.000004
2.500	3	2.4000	0.17215	0.644452	0.860332	0.215880	0.000005
2.750	3	2.6500	0.17215	0.644452	0.860218	0.215766	0.000004
3.000	2	2.8500	0.25822	0.966678	1.291035	0.324357	0.000011
3.500	2	3.3500	0.25822	0.966678	1.290620	0.323942	0.000007
4.000	2	3.8500	0.25822	0.966678	1.290356	0.323678	0.000004
4.500	2	4.3500	0.25822	0.966678	1.290176	0.323498	0.000003
5.000	2	4.8500	0.25822	0.966678	1.290049	0.323371	0.000003

NOTE:

⁽¹⁾ Given to six decimal places for purposes of computation. After subtracting from M_w the final result should be rounded to four places.

TABLE B3 VALUES OF (1 + cosec α') FOR α = 14 deg. 30 min AND LEAD ANGLES FROM 0 deg. TO 5 deg.

Lead Ar	ngle λ			Lead Angle λ			
deg.	min	1 + cosec α'	Difference	deg.	min	1 + cosec α'	Difference
1		2	3		1	2	3
0	0	4.99393		2	30	4.99748	
	5	393	0		35	772	24
	10	394	1		40	797	25
	15	396	2		45	823	26
	20	399	3		50	850	27
	25	403	4		55	877	27
			4				28
				3	0	905	
	30	407			5	934	29
	35	412	5		10	964	30
	40	418	6		15	995	31
	45	425	7		20	5.00026	31
	50	432	7		25	058	32
	55	440	8				33
			9		30	091	
				l <u>į</u>	35	125	34
1	0	449			40	160	35
	5	459	10		45	195	35
	10	470	11		50	231	36
	15	481	-11	l	55	268	37
	20	493	12	il .			38
	25	506	13	4	0	306	
			14		5	345	39
	30	520			10	384	39
	35	535	15	l.	15	424	40
	40	550	15		20	465	41
	45	566	16		25	507	42
	50	583	17			_	43
	55	601	18	l	30	550	
			19	li.	35	593	43
_	_			ll.	40	637	44
2	0	620		ll	45	682	45
	5	639	19		50	728	46
	10	659	20		55	775	47
	15	680	21	ll .			48
	20	702	22	5	0	823	
	25	725	23		5	871	48
			23		10	920	49

threads, no smaller wire than the best-size wire given in Table B2 shall be used. There can be instances when the best-size wire will touch the thread root. Hence, a check should always be made to ensure that the wires do not touch the thread root.

B2.3 Multiple-Start External Threads

Multiple-start threads commonly have lead angles greater than 5 deg. In those exceptional cases that have smaller lead angles, the procedures described above may be applied. For larger lead angles there are two procedures available that give almost identical results; that is, the discrepancy between the values obtained for the lead angle correction c is well within the possible observational error in making the measurement of pitch diameter. The methods are those of Marriner and Wood [4], based on the analytical approach of Gary [3] and Vogel [2].

It is necessary to determine the best-size wire for the individual thread, as the size is dependent on the lead angle of the thread. This determination is simplified by extracting from Table B4 the wire diameter (interpolating if necessary) for a 1 in. axial pitch screw and dividing by the threads/in. Thus

$$w = w_1/n \tag{7}$$

The pitch diameter is given by formulas, as follows:

$$d_2 = M_w - (C + c) \tag{8}$$

where

 d_2 = pitch diameter

 M_w = measurement over wires

$$C = w(1 + \csc \alpha) - (\cot \alpha)/2n$$
 (9)

= 4.993929w - 1.933357/n

$$c = 2(OP - OQ) \text{ of Fig. B1} \tag{10}$$

Tabular values for $(C + c)_1$ for a 1 in. axial pitch screw, which should be divided by the threads/in. for a given case, are also given in Table B4 and [2].

In Fig. B1 the actual points of contact of the wire with the thread flanks are at A and B. Under certain conditions a wire may contact one flank at two points, in which case it is advisable to use a ball, equal in diameter to the wire. The value of c is the same for a ball as for a wire. The conditions determining single or double contact are dealt with below.

To evaluate c

$$OP = \gamma \cos \alpha \cos \beta + \frac{\frac{w}{2} \left(\frac{l}{2\pi} \sin \beta + \gamma \sin \alpha \cos \beta\right)}{\sqrt{\gamma^2 + \left(\frac{l}{2\pi}\right)^2}}$$
(11)

$$OQ = R + \frac{w}{2} \csc \alpha \tag{12}$$

where

- γ = distance from contact point A to a point L on the thread axis, measured parallel to an element of the thread flank, in the axial plane containing LA
- β = (designated the "key angle" by Vogel) angle in a plane perpendicular to the thread axis between lines connecting the point O on the thread axis to the axis of the wire (or center of the ball) and to the point of contact of the wire and thread flank, respectively

The values of β and γ are determined by:

$$\sin \beta = \frac{\frac{w}{2} \left(\frac{l \cos \beta}{2\pi \gamma \cos \alpha} - \tan \alpha \sin \beta \right)}{\sqrt{\gamma^2 + \left(\frac{l}{2\pi}\right)^2}}$$
 (13)

$$\gamma = \frac{R}{\cos \alpha} + \frac{\left(\frac{w}{2} \gamma \cot \alpha\right)}{\sqrt{\gamma^2 + \left(\frac{l}{2\pi}\right)^2}} + \frac{l\beta}{2\pi \sin \alpha} \quad (14)$$

These are simultaneous equations in β and γ which cannot be solved directly but can be solved by iteration. Letting $\beta = 0$, the first approximation for γ is

$$\gamma_0 = R \sec \alpha + \frac{w}{2} \cot \alpha \tag{15}$$

This approximate value of γ is entered in the right-hand side of Eq. (13) to obtain a new value $\beta = \beta_1$. Then this new value of β is entered in the right-hand side of Eq. (14), together with the first approximation of γ , to obtain a new value of $\gamma = \gamma_1$. Then γ_1 and β_1 are entered in Eq. (13) to obtain a new $\beta = \beta_2$. This process is repeated until the values of β and γ repeat themselves to the required degree of accuracy. Their final values are then entered in Eqs. (11) and (12) to obtain the lead angle correction given by Eq. (10).


TABLE B4 BEST-WIRE DIAMETERS AND CONSTANTS FOR LARGE LEAD ANGLES, 1 in. AXIAL PITCH STUB ACME THREADS (29 deg.)


I III. ANAL FITCH STOB ACIVIE THREADS (29 deg.)									
Lead Angle λ,	1-Start T	1-Start Threads, in. 2-Start T		hreads, in.	Lead Angle λ,	2-Start TI	hreads, in.	3-Start TI	nreads, in.
deg.	W ₁	$(C + c)_{1}$	W ₁	$(C + c)_1$	deg.	w ₁	$(C + c)_1$	w ₁	$(C + c)_1$
1	2	3	4	5	1	4	5	6	7
5.0	0.51450	0.64311	0.51443	0.64290	10.0	0.50864	0.63518	0.50847	0.63463
5.1	0.51442	0.64301	0.51435	0.64279	10.1	0.50849	0.63498	0.50831	0.63442
5.2	0.51435	0.64291	0.51427	0.64268	10.2	0.50834	0.63478	0.50815	0.63420
5.3	0.51427	0.64282	0.51418	0.64256	10.3	0.50818	0.63457	0.50800	0.63399
5.4	0.51419	0.64272	0.51410	0.64245	10.4	0.50802	0.63436	0.50784	0.63378
5.5	0.51411	0.64261	0.51401	0.64233	10.5	0.50786	0.63416	0.50768	0.63356
5.6	0.51403	0.64251	0.51393	0.64221	10.6	0.50771	0.63395	0.50751	0.63333
5.7	0.51395	0.64240	0.51384	0.64209	10.7	0.50755	0.63375	0.50735	0.63311
5.8	0.51386	0.64229	0.51375	0.64196	10.8	0.50739	0.63354	0.50718	0.63288
5.9	0.51377	0.64218	0.51366	0.64184	10.9	0.50723	0.63333	0.50701	0.63265
6.0	0.51368	0.64207	0.51356	0.64171	11.0	0.50707	0.63313	0.50684	0.63242
6.1	0.51359	0.64195	0.51346	0.64157	11.1	0.50691	0.63292	0.50667	0.63219
6.2	0.51350	0.64184	0.51336	0.64144	11.2	0.50674	0.63271	0.50649	0.63195
6.3	0.51340	0.64172	0.51327	0.64131	11.3	0.50658	0.63250	0.50632	0.63172
6.4	0.51330	0.64160	0.51317	0.64117	11.4	0.50641	0.63228	0.50615	0.63149
6.5	0.51320	0.64147	0.51306	0.64103	11.5	0.50623	0.63206	0.50597	0.63126
6.6	0.51310	0.64134	0.51296	0.64089	11.6	0.50606	0.63184	0.50579	0.63102
6.7	0.51300	0.64122	0.51285	0.64075	11.7	0.50589	0.63162	0.50561	0.63078
6.8	0.51290	0.64110	0.51275	0.64061	11.8	0.50571	0.63140	0.50544	0.63055
6.9	0.51280	0.64097	0.51264	0.64046	11.9	0.50553	0.63117	0.50526	0.63031
7.0	0.51270	0.64085	0.51254	0.64032	12.0	0.50535	0.63095	0.50507	0.63006
7.1	0.51259	0.64072	0.51243	0.64017	12.1	0.50517	0.63072	0.50488	0.62981
7.2	0.51249	0.64060	0.51232	0.64002	12.2	0.50500	0.63050	0.50470	0.62956
7.3	0.51238	0.64047	0.51221	0.63987	12.3	0.50482	0.63027	0.50451	0.62931
7.4	0.51227	0.64034	0.51209	0.63972	12.4	0.50464	0.63004	0.50432	0.62906
7.5	0.51217	0.64021	0.51198	0.63957	12.5	0.50445	0.62981	0.50413	0.62881
7.6	0.51206	0.64008	0.51186	0.63941	12.6	0.50427	0.62958	0.50394	0.62856
7.7	0.51196	0.63996	0.51174	0.63925	12.7	0.50408	0.62934	0.50375	0.62830
7.8	0.51186	0.63983	0.51162	0.63909	12.8	0.50389	0.62911	0.50356	0.62805
7.9	0.51175	0.63970	0.51150	0.63892	12.9	0.50371	0.62888	0.50336	0.62779
8.0	0.51164	0.63957	0.51138	0.63876	13.0	0.50352	0.62865	0.50316	0.62752
8.1	0.51153	0.63944	0.51125	0.63859	13.1	0.50333	0.62841	0.50295	0.62725
8.2	0.51142	0.63930	0.51113	0.63843	13.2	0.50313	0.62817	0.50275	0.62699
8.3	0.51130	0.63916	0.51101	0.63827	13.3	0.50293	0.62792	0.50255	0.62672
8.4	0.51118	0.63902	0.51088	0.63810	13.4	0.50274	0.62768	0.50235	0.62646
8.5	0.51105	0.63887	0.51075	0.63793	13.5	0.50254	0.62743	0.50214	0.62619
8.6	0.51093	0.63873	0.51062	0.63775	13.6	0.50234	0.62718	0.50194	0.62592
8.7	0.51081	0.63859	0.51049	0.63758	13.7	0.50215	0.62694	0.50173	0.62564
8.8	0.51069	0.63845	0.51035	0.63740	13.8	0.50195	0.62670	0.50152	0.62537
8.9	0.51057	0.63831	0.51022	0.63722	13.9	0.50175	0.62645	0.50131	0.62509
9.0	0.51044	0.63817	0.51008	0.63704	14.0	0.50155	0.62621	0.50110	0.62481
9.1	0.51032	0.63802	0.50993	0.63685	14.1	0.50135	0.62596	0.50089	0.62453
9.2 9.3	0.51019 0.51006	0.63788 0.63774	0.50979 0.50965	0.63667	14.2	0.50115 0.50094	0.62571	0.50068	0.62425
9.3 9.4	0.51006	0.63774	0.50965	0.63649 0.63630	14.3 14.4	0.50094	0.62546 0.62520	0.50046 0.50024	0.62397 0.62368
		1		'	1				
9.5	0.50981	0.63744	0.50937 0.50922	0.63612	14.5	0.50051	0.62494	0.50003	0.62340
9.6 9.7	0.50968 0.50955	0.63730 0.63715	0.50922	0.63593	14.6 14.7	0.50030	0.62468	0.49981	0.62312
9.7	0.50955	0.63715	0.50908	0.63574 0.63555	14.7	0.50009 0.49988	0.62442 0.62417	0.49959 0.49936	0.62283 0.62253
9.9	0.50941	0.63685	0.50893	0.63537	14.8	0.49966	0.62391	0.49936	0.62234
	l	ŧ					1	1	1
10.0	0.50913	0.63670	0.50864	0.63518	15.0	0.49945	0.62365	0.49891	0.62195

TABLE B4 BEST-WIRE DIAMETERS AND CONSTANTS FOR LARGE LEAD ANGLES, 1 in. AXIAL PITCH STUB ACME THREADS (29 deg.) (CONT'D)

Land A-Start Threads, in. 4-Start Threads, in. Lead Angle	Lead	ad 3-Start Threads in 4-Start Threads in Lead 3-Start Threads in								
1	Angle λ ,		· · · · · · · · · · · · · · · · · · ·	 		Angle λ,	3-Start TI	·	4-Start Ti	1
13.0		 	 	·	<u> </u>	 	· · · · · · · · · · · · · · · · · · ·	· · · · · ·		<u> </u>
13.1 0.50295 0.62295 0.50275 0.62869 1.052056 0.62689 1.052056 0.62689 1.052056 0.62689 1.052056 0.62689 1.052056 0.62689 1.052056 0.62689 1.052056 0.62689 1.052056 0.62689 1.052056 0.62681 1.81 0.49074 0.61114 0.48999 0.61004 13.4 0.50235 0.62646 0.50215 0.62638 1.84 0.49027 0.61114 0.48999 0.60084 13.6 0.50194 0.62592 0.50173 0.625261 1.81 0.49020 0.61016 0.48941 0.60934 13.7 0.50173 0.52527 0.50131 0.62691 1.82 0.48938 0.60076 0.48911 0.60817 13.9 0.50131 0.52509 0.50109 0.62440 18.9 0.48910 0.60941 0.48859 0.60742 14.1 0.500089 0.62451 0.50007 0.62411 19.0 0.48862 0.60034 0.60742 14.3	1	6	7	8	9	1	6	7	8	9
13.2 0.50275 0.62899 0.50255 0.62891 18.2 0.49101 0.61182 0.49074 0.61101 13.4 0.50255 0.62864 0.50215 0.62853 18.4 0.49047 0.61114 0.48999 0.60964 13.5 0.50214 0.62869 0.50173 0.62852 18.6 0.49927 0.61080 0.48971 0.60981 13.6 0.50152 0.62584 0.50152 0.62846 0.50152 0.60981 0.60981 0.60981 0.60981 0.60981 0.60981 0.60981 0.60981 0.60981 0.60981 0.60891 0.60981 0.60981 0.60981 0.60981 0.60981 0.60881 0.60911 0.48823 0.60960 0.60864 0.60891 0.60864 0.60864 0.60864 0.60864 0.60864 0.60864 0.62481 0.80864 0.60981 0.60864 0.60864 0.62381 0.90864 0.488230 0.60964 0.488230 0.60964 0.488230 0.60964 0.488230 0.60964 0.48824<		1	1				0.49154	0.61250	0.49109	0.61109
13.3 0.50255 0.62849 0.50215 0.62853 18.4 0.49024 0.61148 0.498997 0.60964 13.5 0.50214 0.62849 0.50215 0.62853 18.5 0.49020 0.61080 0.48971 0.60928 13.6 0.50144 0.62582 0.50173 0.62526 18.6 0.48902 0.61045 0.48943 0.60931 13.6 0.50184 0.62584 0.50152 0.62498 18.7 0.48985 0.60976 0.48815 0.60854 13.8 0.50152 0.62597 0.50131 0.62469 18.8 0.48938 0.60976 0.48815 0.60780 14.0 0.50110 0.62481 0.50087 0.62411 19.0 0.48820 0.60960 0.48830 0.60774 14.2 0.50068 0.62425 0.50043 0.62381 19.2 0.48825 0.60960 0.48830 0.60764 14.3 0.50068 0.62337 0.50021 0.62321 0.49871 0.60668 0.48712 </td <td></td> <td>1</td> <td></td> <td></td> <td>1</td> <td></td> <td>0.49127</td> <td>0.61216</td> <td>0.49082</td> <td>0.61073</td>		1			1		0.49127	0.61216	0.49082	0.61073
13.4		1			0.62639				0.49054	
13.5		1	1				0.49074		0.49027	0.61001
13.6			1	1	0.62583	18.4	0.49047	0.61114	0.48999	0.60964
13.7 0.50173 0.62584 0.50152 0.62537 0.50131 0.62489 18.8 0.48938 0.60976 0.48887 0.60817 13.9 0.50131 0.62509 0.50109 0.62440 18.9 0.48910 0.60966 0.48830 0.60780 14.0 0.50110 0.62481 0.50087 0.62431 19.0 0.48882 0.60966 0.48830 0.60704 14.1 0.50088 0.62425 0.50034 0.62381 19.1 0.48854 0.60671 0.48803 0.60704 14.2 0.50068 0.62425 0.50021 0.62321 19.2 0.48825 0.60835 0.48771 0.60628 14.4 0.50004 0.62268 0.49997 0.62262 19.5 0.48769 0.60729 0.48644 0.60612 14.5 0.50003 0.62243 0.49977 0.62262 19.5 0.48712 0.60639 0.48644 0.6014 14.6 0.49861 0.62223 0.49824 0.62232 19.6		1	1	1			1			
13.8			1					1		
13.9			1	1				1		1
14.0		1	1	1	1			(1	
14.1 0.50089 0.62453 0.50065 0.62351 19.2 0.48825 0.60835 0.48900 0.60704 14.2 0.50068 0.62425 0.50043 0.62351 19.2 0.48825 0.60335 0.48771 0.60666 14.3 0.50064 0.62397 0.50021 0.62262 19.3 0.48797 0.60799 0.48742 0.60659 14.4 0.50024 0.62386 0.49999 0.62262 19.5 0.48741 0.60729 0.48684 0.60535 14.6 0.49981 0.62312 0.49955 0.62232 19.6 0.48741 0.60729 0.48664 0.60531 14.7 0.49950 0.62283 0.49932 0.62202 19.7 0.48663 0.60657 0.48625 0.60647 14.8 0.49914 0.62294 0.49887 0.62141 19.9 0.48625 0.60621 0.48566 0.60398 15.1 0.49869 0.62166 0.49842 0.62049 20.2 0.60549 0.48536			1	1	Į.	11		ł	0.48859	0.60780
14.2 0.50068 0.62425 0.50043 0.62351 19.2 0.48725 0.60835 0.48771 0.60668 14.3 0.50024 0.62387 0.50021 0.62321 19.3 0.48769 0.60799 0.48713 0.60659 14.4 0.50003 0.62340 0.49977 0.62262 19.5 0.48741 0.60793 0.48684 0.60552 14.6 0.49981 0.62323 0.49932 0.62202 19.5 0.48741 0.6093 0.48655 0.60541 14.7 0.49959 0.62283 0.49932 0.62202 19.7 0.48683 0.6057 0.48655 0.60437 14.8 0.49936 0.62253 0.49910 0.62172 19.8 0.48655 0.60635 0.60437 14.9 0.49814 0.62224 0.62161 19.0 0.48626 0.60585 0.48656 0.60329 15.1 0.498891 0.62165 0.60437 0.48626 0.60329 0.48566 0.60329 15.2 0.49846 0.62137 0.49812 0.62040 0.48597 0.60549 0.4			1		E .		l .		1	
14.3 0.50046 0.62397 0.50021 0.62321 19.3 0.48797 0.60799 0.48742 0.60628 14.4 0.50024 0.62368 0.49999 0.62291 19.4 0.48769 0.60764 0.48713 0.60592 14.6 0.50003 0.62340 0.49955 0.62232 19.6 0.48711 0.60693 0.48655 0.60514 14.7 0.49959 0.62283 0.49932 0.62202 19.7 0.48683 0.60621 0.48596 0.60437 14.8 0.49914 0.62224 0.49887 0.62117 19.8 0.48656 0.60621 0.48566 0.60831 15.0 0.49891 0.62195 0.49864 0.62110 20.0 0.48597 0.60585 0.48566 0.60329 15.1 0.49896 0.62166 0.49842 0.62040 20.1 0.48466 0.60320 15.2 0.49842 0.62106 0.49795 0.62041 0.48456 0.60241 <td< td=""><td></td><td></td><td>1</td><td></td><td></td><td></td><td>1</td><td></td><td>l .</td><td>1</td></td<>			1				1		l .	1
14.4 0.50024 0.62368 0.49999 0.62291 19.4 0.48769 0.60764 0.48713 0.60550 14.5 0.50003 0.62340 0.49977 0.62262 19.5 0.48741 0.60793 0.48684 0.60552 14.6 0.49981 0.62223 0.49932 0.62202 19.7 0.48683 0.6057 0.48625 0.60475 14.8 0.49936 0.62253 0.49910 0.62171 19.8 0.48655 0.60657 0.48566 0.60398 15.0 0.49811 0.62225 0.49864 0.62141 19.9 0.48626 0.60585 0.48566 0.60398 15.1 0.49889 0.62166 0.49842 0.62080 20.1 0.48566 0.60398 15.2 0.498840 0.62137 0.62080 20.1 0.48766 0.60320 15.5 0.498842 0.62108 0.49771 0.61985 20.4 0.48476 0.60241 15.5 0.49771 0.61985 20.4 0.48465 0.60162<		1	1	1			i .		1	
14.5 0.50003 0.62340 0.49977 0.62262 19.5 0.48741 0.60729 0.48684 0.60552 14.6 0.49981 0.62312 0.49955 0.62232 19.6 0.48712 0.60693 0.48625 0.60517 14.8 0.49936 0.62253 0.49910 0.62172 19.8 0.48655 0.60621 0.48696 0.60437 14.8 0.49914 0.62224 0.49887 0.62141 19.9 0.48626 0.60565 0.48566 0.60359 15.0 0.49869 0.62166 0.49842 0.62080 20.1 0.48566 0.60559 15.1 0.49869 0.62137 0.49819 0.62041 20.2 0.48566 0.60320 15.2 0.49846 0.62137 0.49819 0.62041 20.2 0.48566 0.60320 15.3 0.49876 0.62078 0.49771 0.61985 20.4 0.48446 0.62011 15.5 0.49778 0.62048 0.49777 0.61985 <		1	1				ì		1	1
14.6 0.49981 0.62312 0.49955 0.62232 19.6 0.48712 0.60693 0.48655 0.60514 14.7 0.49959 0.62283 0.49932 0.62202 19.7 0.48683 0.60657 0.48526 0.60473 14.8 0.49914 0.62224 0.49887 0.62110 20.0 0.48596 0.60585 0.48566 0.60398 15.0 0.49891 0.62195 0.49864 0.62110 20.0 0.48597 0.60549 0.48566 0.60320 15.1 0.49864 0.62195 0.49864 0.62049 20.2 0.48566 0.60320 15.2 0.49846 0.62108 0.49795 0.62047 20.2 0.48466 0.60241 15.3 0.49824 0.62108 0.49747 0.61953 20.5 0.48445 0.60201 15.5 0.49778 0.62048 0.49747 0.61953 20.5 0.48384 0.60162 15.5 0.49754 0.62017 0.49373 0.61951 20.6 0.48354 0.60123 15.7 0.49455 0.61956		ı	1			II	ı			Ì
14.7 0.49959 0.62283 0.49932 0.62202 19.7 0.48683 0.60657 0.48625 0.60475 14.8 0.49936 0.62253 0.49910 0.62172 19.8 0.48665 0.60685 0.48566 0.60437 14.9 0.49891 0.62195 0.49864 0.62110 20.0 0.48597 0.60549 0.48536 0.60359 15.1 0.49869 0.62166 0.49842 0.62080 20.1 0.48506 0.60320 15.2 0.49846 0.6217 0.49879 0.62017 20.3 0.48476 0.60281 15.3 0.49824 0.62108 0.49795 0.62017 20.3 0.48445 0.60281 15.4 0.49801 0.62078 0.49711 0.61985 20.4 0.48415 0.60202 15.5 0.49778 0.62048 0.49747 0.61985 20.5 0.48384 0.60123 15.7 0.49731 0.61987 0.49699 0.61889 20.7 0.48384 0			1					,		
14.8 0.49914 0.62223 0.49910 0.62172 19.8 0.48655 0.60621 0.48596 0.60437 14.9 0.49914 0.62224 0.49887 0.62110 20.0 0.48597 0.60585 0.48566 0.60398 15.0 0.49869 0.62166 0.49842 0.62080 20.1 0.48566 0.60320 15.2 0.49846 0.62137 0.49819 0.62049 20.2 0.48476 0.60281 15.3 0.49824 0.62108 0.49757 0.60985 20.4 0.48445 0.60201 15.4 0.49701 0.62048 0.49771 0.61985 20.4 0.48415 0.60202 15.5 0.49778 0.62048 0.49771 0.61985 20.5 0.48384 0.60162 15.7 0.49731 0.61987 0.49623 0.61921 20.6 0.48384 0.60162 15.8 0.49675 0.61857 20.8 0.48232 0.60042 15.9 0.49683 0.61926 <		ł.	1					ł	i	
14.9 0.49914 0.62224 0.49887 0.62141 19.9 0.48626 0.60585 0.48566 0.60398 15.0 0.49869 0.62166 0.49842 0.62080 20.1 0.48566 0.60320 15.2 0.49866 0.62137 0.49819 0.62049 20.2 0.48476 0.60281 15.3 0.49824 0.62108 0.49795 0.62017 20.3 0.48445 0.60201 15.4 0.49801 0.62078 0.49747 0.61985 20.4 0.48415 0.60202 15.5 0.49778 0.62017 0.49747 0.61985 20.4 0.48384 0.60162 15.6 0.49754 0.62017 0.49723 0.61921 20.6 0.48334 0.601623 15.7 0.49731 0.61986 0.49675 0.61885 20.9 0.48292 0.60042 15.9 0.49683 0.61926 0.49675 0.61885 20.9 <t< td=""><td></td><td>1</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></t<>		1								
15.0 0.49891 0.62195 0.49864 0.62110 20.0 0.48597 0.60549 0.48536 0.60359 15.1 0.49869 0.62166 0.49842 0.62080 20.1 0.48506 0.60320 15.2 0.49846 0.62137 0.49819 0.62049 20.2 0.48476 0.60241 15.3 0.49824 0.62108 0.49771 0.61985 20.4 0.48445 0.60241 15.4 0.49801 0.62078 0.49771 0.61985 20.4 0.48415 0.60220 15.5 0.49778 0.62048 0.49773 0.61925 20.5 0.48384 0.60123 15.7 0.49731 0.61987 0.49689 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49675 0.61887 20.8 0.48261 0.60002 16.0 0.49683 0.61956 0.49627 0.61793 21.0 0.48230 0.59961 16.1 0.49635 0.61864 </td <td></td> <td></td> <td>I</td> <td></td> <td>1</td> <td></td> <td></td> <td></td> <td></td> <td></td>			I		1					
15.1 0.49869 0.62166 0.49842 0.62080 20.1 0.48846 0.62137 0.49819 0.62049 20.2 0.48476 0.60221 15.3 0.49824 0.62108 0.49975 0.62017 20.3 0.48445 0.60241 15.4 0.49801 0.62078 0.49771 0.61985 20.4 0.48415 0.60202 15.5 0.49778 0.62048 0.49747 0.61985 20.5 0.48344 0.60162 15.6 0.49754 0.62017 0.49723 0.61921 20.6 0.48354 0.60162 15.7 0.49731 0.61987 0.49699 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49675 0.61825 20.9 0.48292 0.60042 16.0 0.49659 0.618895 0.61825 20.9 0.48230 0.59961 16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48230 0.59961 16.2 <td></td> <td></td> <td>1</td> <td>1</td> <td>1</td> <td>11</td> <td>i .</td> <td></td> <td></td> <td>ŀ</td>			1	1	1	11	i .			ŀ
15.2 0.49846 0.62137 0.49819 0.62049 20.2 0.48476 0.60281 15.3 0.49824 0.62078 0.49771 0.61985 20.4 0.48445 0.60201 15.4 0.49801 0.62078 0.49771 0.61985 20.4 0.48415 0.60202 15.5 0.49778 0.62048 0.49747 0.61985 20.5 0.48384 0.60162 15.6 0.49754 0.62017 0.49723 0.61921 20.6 0.48354 0.60123 15.7 0.49731 0.61987 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49657 0.618857 20.8 0.48292 0.60042 15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48261 0.60002 16.0 0.49659 0.61895 0.49627 0.61793 21.0 0.48261 0.6002 16.2 0.49611 0.61833 0.49577 0.61727 21.2			1]		0.48597	0.60549		ì
15.3 0.49824 0.62108 0.49795 0.62017 20.3 0.48445 0.60241 15.4 0.49901 0.62078 0.49771 0.61985 20.4 0.48415 0.60202 15.5 0.49778 0.62048 0.49747 0.61953 20.5 0.48384 0.60162 15.6 0.49754 0.62017 0.49723 0.61921 20.6 0.48384 0.60162 15.7 0.49731 0.61987 0.49699 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49651 0.61857 20.8 0.48292 0.60042 15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48230 0.59961 16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48198 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49527 0.61684 21.3 0.48166			I .	I .						1
15.4 0.49801 0.62078 0.49771 0.61985 20.4 0.48415 0.60202 15.5 0.49778 0.62048 0.49747 0.61953 20.5 0.48384 0.60162 15.6 0.49754 0.62017 0.49639 0.61889 20.7 0.48323 0.60083 15.7 0.49731 0.61987 0.49689 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49657 0.61887 20.8 0.48232 0.60042 15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48261 0.60002 16.0 0.49655 0.61895 0.49627 0.61793 21.0 0.48230 0.599961 16.1 0.49655 0.61864 0.49602 0.61760 21.1 0.48186 0.59879 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49586 0.61801 0.49552 0.61664<			l .		1				Į.	
15.5 0.49778 0.62048 0.49747 0.61953 20.5 0.48384 0.60162 15.6 0.49754 0.62017 0.49723 0.61921 20.6 0.48354 0.60123 15.7 0.49707 0.61987 0.49699 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49651 0.61857 20.8 0.48292 0.60042 15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48261 0.60002 16.0 0.49659 0.61895 0.49627 0.61793 21.0 0.48230 0.59961 16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48198 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49562 0.61801 0.49552 0.61694 21.3 0.48134 0.59936 16.4 0.49562 0.61770 0.49527 0.61661 </td <td></td> <td></td> <td>l .</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>ł</td> <td></td>			l .						ł	
15.6 0.49754 0.62017 0.49723 0.61921 20.6 0.48354 0.60123 15.7 0.49731 0.61987 0.49699 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49675 0.61857 20.8 0.48222 0.60042 15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48230 0.59961 16.0 0.49659 0.61895 0.49627 0.61760 21.1 0.48198 0.59920 16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48198 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49586 0.61801 0.49552 0.61694 21.3 0.48134 0.59838 16.4 0.49562 0.61770 0.49527 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61766 0.49476 0.61594 </td <td></td> <td>i</td> <td>1</td> <td></td> <td></td> <td></td> <td>• • • •</td> <td></td> <td></td> <td></td>		i	1				• • • •			
15.7 0.49731 0.61987 0.49699 0.61889 20.7 0.48323 0.60083 15.8 0.49707 0.61956 0.49675 0.61857 20.8 0.48292 0.60042 15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48261 0.60002 16.0 0.49659 0.61864 0.496027 0.61793 21.0 0.48230 0.59961 16.1 0.49635 0.61864 0.49602 0.61777 21.2 0.48166 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59920 16.3 0.49586 0.61801 0.49552 0.61664 21.3 0.48103 0.5973 16.5 0.49537 0.61770 0.49527 0.61661 21.4 0.48103 0.59797 16.5 0.49537 0.61760 0.49476 0.61628 21.5 0.48701 0.59756 16.6 0.49448 0.61675 0.49446 0.61560 </td <td></td> <td></td> <td>E .</td> <td></td> <td></td> <td></td> <td>!</td> <td></td> <td></td> <td></td>			E .				!			
15.8 0.49707 0.61956 0.49675 0.61857 20.8 0.48292 0.60042 15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48261 0.60002 16.0 0.49659 0.61895 0.49627 0.61793 21.0 0.48230 0.59961 16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48198 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49586 0.61801 0.49552 0.61661 21.4 0.48103 0.599879 16.5 0.49537 0.61770 0.49527 0.61661 21.4 0.48701 0.59797 16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560<							1		1	
15.9 0.49683 0.61926 0.49651 0.61825 20.9 0.48261 0.60002 16.0 0.49659 0.61895 0.49627 0.61793 21.0 0.48230 0.59961 16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48198 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49586 0.61801 0.49552 0.61694 21.3 0.48134 0.59838 16.4 0.49562 0.61770 0.49527 0.61661 21.4 0.48103 0.59797 16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49426 0.61526 </td <td></td> <td>5</td> <td></td> <td>1</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>		5		1						
16.0 0.49659 0.61895 0.49627 0.61793 21.0 0.48230 0.59961 16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48198 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49586 0.61801 0.49552 0.61694 21.3 0.48134 0.59838 16.4 0.49562 0.61770 0.49527 0.61661 21.4 0.48103 0.59797 16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49475 0.61526 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 </td <td></td> <td></td> <td></td> <td></td> <td>t I</td> <td></td> <td>I</td> <td></td> <td></td> <td></td>					t I		I			
16.1 0.49635 0.61864 0.49602 0.61760 21.1 0.48198 0.59920 16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49586 0.61801 0.49552 0.61694 21.3 0.48134 0.59838 16.4 0.49562 0.61770 0.49527 0.61661 21.4 0.48103 0.59797 16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 </td <td></td> <td></td> <td></td> <td></td> <td></td> <td>1</td> <td></td> <td></td> <td></td> <td></td>						1				
16.2 0.49611 0.61833 0.49577 0.61727 21.2 0.48166 0.59879 16.3 0.49586 0.61801 0.49552 0.61694 21.3 0.48134 0.59838 16.4 0.49562 0.61770 0.49527 0.61661 21.4 0.48103 0.59797 16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47876 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 </td <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>l .</td> <td></td> <td></td> <td></td>							l .			
16.3 0.49586 0.61801 0.49552 0.61694 21.3 0.48134 0.59838 16.4 0.49562 0.61770 0.49527 0.61661 21.4 0.48103 0.59797 16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47910 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 </td <td></td> <td>1</td> <td></td> <td></td> <td></td> <td></td> <td>!</td> <td></td> <td></td> <td></td>		1					!			
16.4 0.49562 0.61770 0.49527 0.61661 21.4 0.48103 0.59797 16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47910 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.							[
16.5 0.49537 0.61738 0.49502 0.61628 21.5 0.48701 0.59756 16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47910 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47745 0.59336 17.6 0.49259 0.										
16.6 0.49512 0.61706 0.49476 0.61594 21.6 0.48040 0.59715 16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47910 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47745 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59236 17.6 0.49259 0.	16.5	i				l .				
16.7 0.49488 0.61675 0.49451 0.61560 21.7 0.48008 0.59674 16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47910 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59236 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47643 0.59250 17.8 0.49206 0.		1	1							
16.8 0.49463 0.61643 0.49425 0.61526 21.8 0.47975 0.59632 16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47910 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59336 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47643 0.59207 17.8 0.49206 0.		0.49488	1	1	(
16.9 0.49438 0.61611 0.49400 0.61492 21.9 0.47943 0.59590 17.0 0.49414 0.61580 0.49375 0.61458 22.0 0.47910 0.59548 17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59336 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47643 0.59207 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.		•	1	i	1		ļ.			
17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59336 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47677 0.59250 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164		1	1				j l			
17.1 0.49389 0.61548 0.49349 0.61424 22.1 0.47878 0.59507 17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59336 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47677 0.59250 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164	17.0	0.49414	0.61580	0.49375	0.61458	22.0			0.47910	
17.2 0.49363 0.61515 0.49322 0.61389 22.2 0.47845 0.59465 17.3 0.49337 0.61482 0.49296 0.61354 22.3 0.47812 0.59422 17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59336 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47647 0.59250 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164	17.1	0.49389	0.61548	0.49349	0.61424					
17.4 0.49311 0.61449 0.49269 0.61319 22.4 0.47778 0.59379 17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59336 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47677 0.59250 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164	17.2	0.49363	0.61515	0.49322	0.61389				0.47845	0.59465
17.5 0.49285 0.61416 0.49243 0.61284 22.5 0.47745 0.59336 17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47677 0.59250 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164				†	0.61354	22.3			0.47812	0.59422
17.6 0.49259 0.61383 0.49217 0.61250 22.6 0.47711 0.59293 17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47677 0.59250 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164	17.4	0.49311	0.61449	0.49269	0.61319	22.4			0.47778	0.59379
17.7 0.49233 0.61350 0.49191 0.61215 22.7 0.47677 0.59250 17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164				I	0.61284	22.5			0.47745	0.59336
17.8 0.49206 0.61316 0.49164 0.61180 22.8 0.47643 0.59207 17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164				l	1 1				0.47711	0.59293
17.9 0.49180 0.61283 0.49137 0.61144 22.9 0.47610 0.59164				0.49191	0.61215	4			0.47677	0.59250
		3	i	1	(I				0.47643	
23.0 0.47577 0.59121	17.9	0.49180	0.61283	0.49137	0.61144	22.9				0.59164
	• • •					23.0			0.47577	0.59121

GENERAL NOTE: This Table is courtesy of the Van Keuren Co.

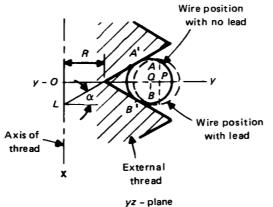

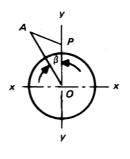

 γ = LA (with lead) $\gamma = LA'$ (with no lead) xy - plane with lead (with no lead, $\beta = 0$)

$\sqrt{\gamma^2 + \left(\frac{1}{2\pi}\right)^2}$	sin β	β (radian)	cosβ	γ	
0.54486 847	0.02337 088	0.02337 301	0.99972 686	0.52978 325	
0.54444 355	0.02226 331	0.02226 515	0.99975 214	0.52934 621	
0.54446 650	0.02232 617	0.02232 833	0.99975 073	0.52936 984	
0.54446 524	0.02232 298	0.02332 483	0.99975 081	0.52936 853	
0.54446 530	0.02232 317	0.02232 502	0.99975 081	0.52936 860	
0.54446 530	0.02232 316	0.02232 501	0.99975 081	0.52936 860	

OP = 0.528433962

OQ = 0.519260196

c = 0.011148

20P = 1.04966 79 = nominal measurement between centers of wires

 $M_w = 20P + w = 1.149868$ in. = nominal measurement over wires

 $M_W = 1.149 868 = \text{actual measurement over wires}$ $d_2 = 1.149 868 - (C + c) \text{ [see Eqs. (8) and (9)]}$

 \bar{C} = 4.993 929 x 0.100 20 - 1.933 375/5 = 0.113 720

C + c = 0.113720 + 0.011148 = 0.124868 $d_2 = 1.149868 - 0.124868 = 1.025000$ (as measured)

FIG. B1 BASIS OF LEAD ANGLE CORRECTION FOR EXTERNAL THREAD

The following calculation exemplifies the process, and the result may be compared with that obtained for the same example by the Vogel method [2] or the Van Keuren method [1, 2].

 $1\frac{1}{8}$ in. - 5, 4 start 29 deg. Acme screw thread $d_2 = 1.025 \text{ basic}$ l = 0.800p = 0.200 $\lambda = 13.95 \, 1927 \, \deg$ $\omega = 0.10020$ (from Table B4) [1, 2] $\alpha = 14.5 \text{ deg.}$ $\sin \alpha = 0.25038\ 00041$ $\cos \alpha = 0.9681476404$ $\tan \alpha = 0.2586175844$ $\cot \alpha = 3.86671 \ 30949$ $\sec \alpha = 1.03290\ 03122$ $\csc \alpha = 3.9939291629$ $l/\pi = 0.3183098862$ R = 0.3191643455 $l/2\pi = 0.12732\ 39545$ $(l/2\pi)^2 = 0.01621 13939$ $l/(2\pi \sin \alpha) = 0.50852\ 28550$ $l/(2\pi\cos\alpha) = 0.13151\ 29523$ $R/\cos\alpha = 0.3296649520$ $\gamma_0 = 0.2739342429$

If the Marriner and Wood equations are applied instead of those of Vogel, we have

$$\sigma - \beta = \frac{\cot^2 \lambda}{\cot \beta - \frac{\tan \alpha}{\tan \lambda}}$$
 (16)

where

$$\sigma = \frac{\pi}{2N_c}$$

 $N_{\rm s}$ = number of starts

 λ = lead angle at pitch line

 α = half-angle of thread in axial plane

This equation may likewise be solved for β by iteration, but various shortcuts are presented in [2], including a short, highly accurate, and nontranscendent formula for β . The value of β in the above example, which satisfies this equation, is 0.02232 480 radian, as compared with 0.02232 501 obtained with the Marriner and Wood formulas. The measurement to the center of the wires is given by the Vogel formula

$$2OP = d_2 \tan^2 \lambda (\sigma - \beta) \csc \beta = 1.0496522 \text{ in.}$$
 (17)

which is 0.0000 157 smaller than the value (1.0496 679) obtained by the Marriner and Wood for-

mulas. As this discrepancy is small compared with the possible error in measurement of M_w , either set of formulas is applicable. Also, the discrepancy between the value of (C + c) by the Marriner and Wood formulas is only 0.000 018 in.

B2.4 Limitations on Three-Wire Measurement of External Threads

When the lead angle and diameter of a thread are such that double contact of the measuring wires occurs, it will be necessary to check the pitch diameter by means of balls rather than wires.

For accurate measurement with wires, single contact on each flank must occur. Measuring wires can be used if the following formula from [4] is satisfied for a specific thread.

$$\tan \alpha > \frac{l}{\pi} \sqrt{1/(R + \frac{w}{2} \cos \alpha \cot \alpha)^2 - 4/D^2} \quad (18)$$

where

 α = half-angle of thread in an axial plane

l = lead

R =distance from thread axis to sharp root (see

w = diameter for measuring wires

D = major diameter of thread

If best-size wires are used so that contact is near the pitch line, the condition for single contact simplifies to

$$\tan \alpha > \frac{2l}{\pi} \sqrt{\frac{1}{d_2^2} - \frac{1}{D^2}}$$
 (19)

Due to the approximate nature of the above formulas, double contact does not necessarily occur when these formulas are not satisfied. If this is not satisfactory, the following formula can be used for a more precise determination.

$$\frac{D}{2} \tan \alpha - \gamma_A \sin \alpha + \frac{l}{2\pi} (\beta_A - \beta_P)$$

$$+ \left(\gamma_A \sin \alpha \sin \beta_A - \frac{l}{2\pi} \cos \beta_A \right)$$

$$\times \sec \beta_P \sin (\beta_A - \beta_P) > 0$$
 (20)

where

- γ_A = final value for γ in the correction calculation (0.52936 8598) would be the γ_A for sample calculation, the results of which are shown above
- $\beta_A = \text{final value for } \beta \text{ in the correction calculation}$ $\beta_P = \cos^{-1} (2\gamma_A \cos \alpha \cos \beta_A/D) \text{ and is a negative angle}$

If the formula is satisfied, double contact does not occur.

B2.5 References

- [1] H. L. Van Keuren, Tables for Precise Measurement of Screws, Catalog and Handbook No. 34, The Van Keuren Co. (1948).
- [2] Werner F. Vogel, New Thread Measuring Formulas, Catalog and Handbook No. 36, Appendix D, The Van Keuren Co. (1955).
- [3] M. Gary, Die Berechnung der Gewinde-Anlagekorrekturen. Physikalisch-Technischen Bundesanstalt, Braunschweig, 21, No. 4 (1955).
- [4] R. S. Marriner and Mrs. J. G. Wood, Rake Correction in the Measurement of Parallel External and Internal Screw Threads, Institute of Mechanical Engineers, London (July 1958).

AMERICAN NATIONAL STANDARDS FOR SCREW THREADS

(Published by The American Society of Mechanical Engineers)

TITLE OF STANDARD

Unified Inch Screw Threads (UN and UNR Thread Form)	
Acceptability — Inch and Metric Screw Threads (UN, UNR, UNJ, M, and MJ)	D1 2M 1006
Acceptability — Inch and Metric Screw Threads (ON, ONA, ONA, M, and MJ) Acme Screw Threads	
Nomenclature, Definitions, and Letter Symbols for Screw Threads	
Stub Acme Screw Threads	
	B1.8-1988
Buttress Inch Screw Threads 7°/45° Form With 0.6 Pitch Basic Height of	D1 0 1070/D100E\
Thread Engagement	
Unified Miniature Screw Threads	
Microscope Objective Thread	
Class 5 Interference-Fit Thread	
Metric Screw Threads — M Profile	
Gages and Gaging for Metric M Screw Threads	B1.16M-1984
Metric Screw Threads for Commercial Mechanical	
Fasteners — Boundary Profile Defined	B1.18M-1982(R1987)
Gages for Metric Screw Threads for Commercial Mechanical	
Fasteners – Boundary Profile Defined	
Pipe Threads, General Purpose (Inch)	
Dryseal Pipe Threads (Inch)	
Dryseal Pipe Threads (Metric Translation of B1.20.3-1976)	
Gaging for Dryseal Pipe Threads (Inch)	B1.20.5-1978
Gaging for Dryseal Pipe Threads (Metric Translation	
of B1.20.5-1978),	
Hose Coupling Screw Threads	
Metric Screw Threads — MJ Profile	B1.21M-1978
Gages and Gaging for MJ Series Metric Screw Threads	B1.22M-1985

The ASME Publications Catalog shows a complete list of all the Standards published by the Society. The catalog and binders for holding these Standards are available upon request.

