

PICTORIAL 11


## PARTS MOUNTING-CHASSIS

Refer to Pictorial 11 for the following steps.

- (✓) Referring to Detail 11A, install the octal plug at the Power Plug location, using the octal socket ring. Position pins 1 and 8 of the socket as shown.
- (✓) L5. Install coil #52-25 at L5 on the chassis, using the transformer mounting clip. Position the coil lugs as shown.

NOTE: Keep the plates of the variable capacitors closed to prevent damage.

- (✓) C131. Install the VFO variable capacitor (#26-28), using four #4 lockwashers, flat metal washers, and 4-40 x 5/16 screws. Bend capacitor lug 1 upward as shown.

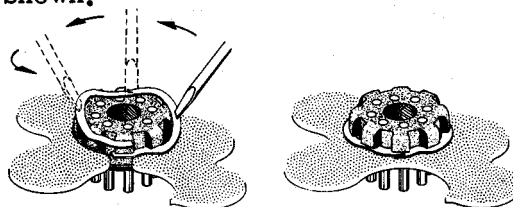

HOLD THE PLUG IN THE CHASSIS HOLE AND PLACE ONE END OF THE RING INTO THE GROOVE OF THE PLUG. USING A SCREWDRIVER, PRESS THE RING INTO THE GROOVE AROUND THE PLUG.

Detail 11A