

# **Manual of Petroleum Measurement Standards Chapter 2—Tank Calibration**

Section 2D—Calibration of Upright Cylindrical  
Tanks Using the Internal Electro-optical  
Distance-ranging Method

ANSI/API MPMS 2.2D  
FIRST EDITION, AUGUST 2003

REAFFIRMED, FEBRUARY 2009

**ISO 7507-4:1995 (Identical), Petroleum and liquid  
petroleum products—Calibration of vertical cylindrical  
tanks—Part 4: Internal electro-optical distance-ranging  
method**





# **Manual of Petroleum Measurement Standards Chapter 2—Tank Calibration**

## **Section 2D—Calibration of Upright Cylindrical Tanks Using the Internal Electro- optical Distance Ranging Method**

**Measurement Coordination Department**

FIRST EDITION, AUGUST 2000



**American  
Petroleum  
Institute**

**Helping You  
Get The Job  
Done Right.<sup>SM</sup>**

## SPECIAL NOTES

API publications necessarily address problems of a general nature. With respect to particular circumstances, local, state, and federal laws and regulations should be reviewed.

API is not undertaking to meet the duties of employers, manufacturers, or suppliers to warn and properly train and equip their employees, and others exposed, concerning health and safety risks and precautions, nor undertaking their obligations under local, state, or federal laws.

Information concerning safety and health risks and proper precautions with respect to particular materials and conditions should be obtained from the employer, the manufacturer or supplier of that material, or the material safety data sheet.

Nothing contained in any API publication is to be construed as granting any right, by implication or otherwise, for the manufacture, sale, or use of any method, apparatus, or product covered by letters patent. Neither should anything contained in the publication be construed as insuring anyone against liability for infringement of letters patent.

Generally, API standards are reviewed and revised, reaffirmed, or withdrawn at least every five years. Sometimes a one-time extension of up to two years will be added to this review cycle. This publication will no longer be in effect five years after its publication date as an operative API standard or, where an extension has been granted, upon republication. Status of the publication can be ascertained from the API Measurement Coordination Segment [telephone (202) 682-8000]. A catalog of API publications and materials is published annually and updated quarterly by API, 1220 L Street, N.W., Washington, D.C. 20005.

This document was produced under API standardization procedures that ensure appropriate notification and participation in the developmental process and is designated as an API standard. Questions concerning the interpretation of the content of this standard or comments and questions concerning the procedures under which this standard was developed should be directed in writing to the standardization manager, American Petroleum Institute, 1220 L Street, N.W., Washington, D.C. 20005. Requests for permission to reproduce or translate all or any part of the material published herein should also be addressed to the general manager.

API standards are published to facilitate the broad availability of proven, sound engineering and operating practices. These standards are not intended to obviate the need for applying sound engineering judgment regarding when and where these standards should be utilized. The formulation and publication of API standards is not intended in any way to inhibit anyone from using any other practices.

Any manufacturer marking equipment or materials in conformance with the marking requirements of an API standard is solely responsible for complying with all the applicable requirements of that standard. API does not represent, warrant, or guarantee that such products do in fact conform to the applicable API standard.

*All rights reserved. No part of this work may be reproduced, stored in a retrieval system, or transmitted by any means, electronic, mechanical, photocopying, recording, or otherwise, without prior written permission from the publisher. Contact the Publisher, API Publishing Services, 1220 L Street, N.W., Washington, D.C. 20005.*

## FOREWORD

Chapter 2.2D of the Manual of Petroleum Measurement Standards (*MPMS*) should be used in conjunction with API Standard, Chapter 2.2A, the Manual Strapping Method.

API publications may be used by anyone desiring to do so. Every effort has been made by the Institute to assure the accuracy and reliability of the data contained in them; however, the Institute makes no representation, warranty, or guarantee in connection with this publication and hereby expressly disclaims any liability or responsibility for loss or damage resulting from its use or for the violation of any federal, state, or municipal regulation with which this publication may conflict.

Suggested revisions are invited and should be submitted to the standardization manager, American Petroleum Institute, 1220 L Street, N.W., Washington, D.C. 20005.



# CONTENTS

	Page
1 SCOPE.....	1
2 NORMATIVE REFERENCES.....	1
3 DEFINITIONS.....	1
4 PRECAUTIONS .....	1
5 EQUIPMENT .....	2
5.1 Electro-optical distance-ranging instrument.....	2
6 GENERAL CONSIDERATIONS .....	2
7 EODR INSTRUMENT SETUP WITHIN THE TANK .....	2
7.1 Instrument Setup .....	2
7.2 Preliminary Procedures .....	2
8 SELECTION OF TARGET POINTS.....	3
9 CALIBRATION PROCEDURE.....	3
10 TOLERANCES .....	3
10.1 Reference Target Point: Distance Verification.....	3
10.2 Reference Target Point: Horizontal and Vertical Angle Verification .....	3
11 OTHER MEASUREMENTS .....	3
12 CALCULATION AND DEVELOPMENT OF CAPACITY TABLES.....	5
APPENDIX A FIELD EQUIPMENT VERIFICATION.....	7
APPENDIX B CALCULATION OF INTERNAL RADII FROM MEASURED PARAMETERS .....	9
APPENDIX C BIBLIOGRAPHY .....	11
Figures	
1 Illustration of Target Positioning on Tank Shell Wall.....	4
2 Illustration of Calibration Procedure .....	4
A-1 Illustration of the Distance Measurement Setup.....	7
Tables	
1 Minimum Number of Target Points Per Set .....	3





# Manual of Petroleum Measurements Standards

## Chapter 2—Tank Calibration

### Section 2D—Calibration of Upright Cylindrical Tanks Using the Internal Electro-optical Distance Ranging Method

#### 0 Introduction

The method described in this part of API *MPMS* Chapter 2 is an alternative to other tank calibration methods such as the strapping method (API *MPMS* Chapter 2, Section 2A), the optical-reference-line method (API *MPMS* Chapter 2, Section 2B) and the optical-triangulation method (API *MPMS* Chapter 2.2C).

The parts of Chapter 2 form part of a series on tank calibration which also includes: Standard 2551, *Measurement and Calibration of Horizontal Tanks*; Standard 2552, *Measurement and Calibration of Spheres and Spheroids*; Standard 2554, *Measurement and Calibration of Tank Cars*; Standard 2555, *Liquid Calibration of Tanks*; Recommended Practice 2556, *Correcting Gauge Tables for Incrustation*; *MPMS* Chapter 7, Calibration of Barge Tanks; *MPMS* Chapter 2.8A, Calibration of Tanks on Ships and Oceangoing Barges; *MPMS* Chapter 2.8B, Establishment of the Location of the Reference Gauge Point and the Gauge Height of Tanks on Marine Tank Vessels.

#### 1 Scope

**1.1** This part specifies a method for the calibration of upright cylindrical tanks having diameters greater than 5 m by means of internal measurements using an electro-optical distance-ranging instrument, and for the subsequent compilation of tank capacity tables. This method is known as the internal electro-optical distance-ranging (EODR) method.

**1.2** This part of Chapter 2 is not applicable to the calibration of abnormally deformed (e.g. dented) tanks or of noncircular tanks.

**1.3** This part of Chapter 2 is applicable to tanks tilted by  $<$  or  $= 3\%$  from the vertical, provided a correction is applied for the measured tilt as described in Chapter 2.2A.

**1.4** This part of Chapter 2 is applicable to tanks with cone-up or cone-down bottoms, as well as to tanks with flat bottoms.

#### 2 Normative References

The following standards contain provisions which, through reference in this text, constitute provisions of this part of Chapter 2. At the time of publication, the editions indicated

were valid. All standards are subject to revision, and parties to agreements based on this part of Chapter 2 are encouraged to investigate the possibility of applying the most recent editions of the standards indicated below. Members of API maintain registers of currently valid API Standards.

#### API

*Manual of Petroleum Measurement Standards (MPMS)*

Chapter 2.2A “Measurement and Calibration of Upright Cylindrical Tanks by the Manual Strapping Method”

Chapter 2.2B “Calibration of Upright Cylindrical Tanks Using the Optical Reference Line Method”

Chapter 2.2C Calibration of Upright Cylindrical Tanks Using the Optical Triangulation Method”

#### IEC<sup>1</sup>

825-1:1993 *Safety of laser products—Part 1: Equipment Classification, Requirements and User's Guide*

#### 3 Definitions

For the purposes of this part of Chapter 2 the definitions given in API *MPMS* Chapter 2.2A and the following definitions apply.

**3.1 reference target point:** Fixed point clearly marked on the inside surface of the tank shell wall.

**3.2 slope distance:** Distance measured from the electro-optical distance-ranging instrument to a target point on any given course of the tank shell wall.

**3.3 target point:** One of a series of points on the inside surface of the tank shell wall to which slope distance, vertical and horizontal angles are measured by use of the electro-optical ranging instrument.

#### 4 Precautions

The general and safety precautions contained in API *MPMS* Chapter 2.2A shall apply to this standard.

In addition, the laser beam emitted by the distance-ranging unit shall conform to IEC 825 for a class 1 laser.

<sup>1</sup>International Electrochemical Commission, 3 Rue de Varembe, P.O. Box 131, CH-1211 Geneva 20, Switzerland.

## 5 Equipment

### 5.1 ELECTRO-OPTICAL DISTANCE-RANGING INSTRUMENT

**5.1.1** The angular measuring part of the instrument shall have an angular graduation and resolution equal to or better than  $\pm 0.0002$  gon\*, a repeatability equal to or better than  $\pm 0.0005$  gon, and an uncertainty equal to or better than  $\pm 0.001$  gon.

**5.1.2** The distance-measuring part of the instrument, used for direct determination of the distances, shall have a graduation and resolution equal to or better than  $\pm 1$  mm, a repeatability equal to or better than  $\pm 2$  mm, and an uncertainty equal to or better than  $\pm 2$  mm.

**5.2 INSTRUMENT MOUNTING** consisting of a tripod which is firm and stable. The legs of the tripod shall be held firm, and steadied by suitable devices such as magnetic bearers.

**5.3 LASER BEAM EMITTER** having a low-power laser beam complying with IEC 825, which is either an integral part of the EODR instrument or a separate device. If the laser beam emitter is a separate device, it may be fitted with a fiber optic light transmitter system and a theodolite telescope eyepiece connection, by which the laser beam may be transmitted through a theodolite, or such that it may be fitted to a theodolite with its axis parallel to the axis of the theodolite. The laser beam may be coincident with the optical axis of the telescope

Note 1: The laser beam emitter is used to position target points on the tank shell.

**5.4 STADIA** a rigid bar, usually 2 m long, such that the graduated length between the two stadia marks remains constant to within  $\pm 0.02$  mm.

### 5.5 EQUIPMENT FOR BOTTOM CALIBRATION (see 11.1)

**5.6 AUXILIARY EQUIPMENT** including:

- a. heavy weights to be set around the instrument to steady the unit;
- b. lighting within the tank, if required.

## 6 General Considerations

**6.1** The EODR instrument shall be maintained so that the values of its measurement uncertainty do not exceed the values given in this part of Chapter 2.

**6.2** Tanks shall only be calibrated after they have been filled at least once with a liquid of density equal to or greater than that of the liquid which they will hold when in use.

Note 2: The hydrostatic test applied to new tanks will satisfy this requirement in most cases.

**6.3** Calibration shall be carried out without interruption.

**6.4** The EODR instrument shall be verified prior to calibration.

The accuracy of the distance-measuring unit as well as the angular measuring unit shall be verified using the procedures recommended by the manufacturer.

The appropriate procedures given in Appendix A shall be used for the verification of equipment in the field.

**6.5** The tank shall be free from vibration and airborne dust particles.

Note 3: The floor of the tanks should be as free as possible from debris, dust and loose scale.

**6.6** Lighting, when required, shall be placed within the tank so as not to interfere with the operation of the EODR instrument.

## 7 EODR Instrument Setup Within the Tank

### 7.1 INSTRUMENT SETUP

**7.1.1** The instrument shall be set up with care, according to the procedure and instructions given by the manufacturers.

**7.1.2** The instrument shall be set up so as to be stable.

If necessary, the tank bottom in the vicinity of the instrument shall be made firm and steady by placing heavy weights in the area.

The legs of the tripod on which the instrument is mounted shall be steadied by use of suitable devices, such as magnetic bearers, to prevent slippage on the tank bottom.

**7.1.3** The instrument shall be located at, or near, the center of the tank.

Note 4: This will ensure that the measured slope distances, at any one horizontal level, do not vary significantly and minimizes the overall uncertainty of slope distance determination.

**7.1.4** The instrument shall be set horizontal, thus ensuring that the vertical axis (standing axis) is vertical.

**7.1.5** The instrument shall be free from external vibration.

**7.1.6** The sighting lines from the instrument to the tank shell wall shall not be obstructed.

### 7.2 PRELIMINARY PROCEDURES

**7.2.1** Switch on the instrument and bring to operating temperature, allowing at least the minimum warm-up time recommended by the manufacturer.

**7.2.2** After the instrument has reached its correct operating temperature, carry out the appropriate procedure given in

\*  $2\pi$  radians = 400 gons = 400 grades

Appendix A. Then select and clearly mark on the tank shell wall two reference target points.

Note 5: The two reference target points should be approximately 100 gon apart and preferably on the same horizontal plane as the instrument.

**7.2.3** The slope distances to each of the two reference target points shall be measured. Two successive readings to each reference target point shall be taken. The two readings, at each point, shall agree within  $\pm 2$  mm. The average distance to each point shall be calculated. The slope distances shall be recorded.

**7.2.4** Wait 15 min and repeat 7.2.3. The repeated slope distances shall agree within  $\pm 2$  mm with the slope distances originally measured. The slope distances shall be recorded.

**7.2.5** If the original and repeated average slope distances do not agree within  $\pm 2$  mm, determine the reason for the difference.

- If the reason for differences is due to the instrument and/or its stability, repeat the procedure from 7.1.
- If the instrument was switched off during the determination of the differences, repeat the procedure from 7.2.1.
- If neither a) nor b) is appropriate, repeat the procedure from 7.2.3.
- Repeat the appropriate procedures until two successive readings agree within  $\pm 2$  mm.

## 8 Selection of Target Points

**8.1** Select two sets of target points per course, one at  $1/5$  to  $1/4$  of course height above the lower horizontal seam, the other at  $1/5$  to  $1/4$  of course height below the upper horizontal seam.

The number of target points per set, on each course of the tank shell wall, is dependent on tank circumference. The minimum number of target points per set, as a function of tank circumference, is given in Table 1 and illustrated in Figure 1.

**8.2** The target points shall be at least 300 mm from any vertical welded seam.

## 9 Calibration Procedure

**9.1** Sight all of the target points along the horizontal plane at each course location, and measure the slope distance, horizontal angle and vertical angle to each, as illustrated in Figure 2.

**9.2** Measure and record the slope distance, horizontal angle and vertical angle to each of the reference target points.

**9.3** Complete the measurements to the target points on each course prior to moving to the next course.

Note 6: Measurements should begin at the bottom course and extend, course by course, to the top.

**9.4** After all measurements on a course are completed, repeat the measurements to the reference target points.

Table 1—Minimum Number of Target Points Per Set

Tank Circumference, <i>C</i> m	Minimum Number of Target Points
$C < \text{or} = 50$	8
$50 < C < \text{or} = 100$	12
$100 < C < \text{or} = 150$	16
$150 < C < \text{or} = 200$	20
$200 < C < \text{or} = 250$	24
$250 < C < \text{or} = 300$	30
$300 < \text{or} = C$	36

Note: A number of points greater than the minimum number of points in Table 1 may be chosen depending on specific circumstances and tank conditions.

**9.5** If the repeated slope distances to the reference target points do not agree with the measurements taken during the setting up of the instrument, within the tolerance given in 10.1, then repeat 9.1 to 9.5.

**9.6** If the horizontal and the vertical angles to the reference target points do not agree within the tolerance given in 10.2, repeat 9.1 to 9.5.

**9.7** If statistical agreement is not obtained between the original and repeated measurements of slope distances, horizontal angles or vertical angles, then the reasons for such disagreement shall be determined, the cause eliminated and the tank calibration procedure repeated.

**9.8** Carry out all measurements without interruption.

## 10 Tolerances

### 10.1 REFERENCE TARGET POINT: DISTANCE VERIFICATION

The slope distance to each of the reference target points before and after the tank calibration has been carried out shall be within  $\pm 2$  mm.

### 10.2 REFERENCE TARGET POINT: HORIZONTAL AND VERTICAL ANGLE VERIFICATION

The horizontal and vertical angle to each of the reference target points before and after the tank calibration has been carried out shall be within  $\pm 0.001$  gon.

## 11 Other Measurements

**11.1** The tank bottom shall be calibrated by the liquid method in accordance with API Standard 2555, or by use of the electro-optical ranging instrument as a surveyor's level or by use of a surveyor's level in accordance with API *MPMS* Chapter 2.2A, or by use of water-filled tubes in accordance with API *MPMS* Chapter 2.2A.

**11.2** The overall height of the reference point at each dip-hatch (upper reference point), if fitted, above the dip-point

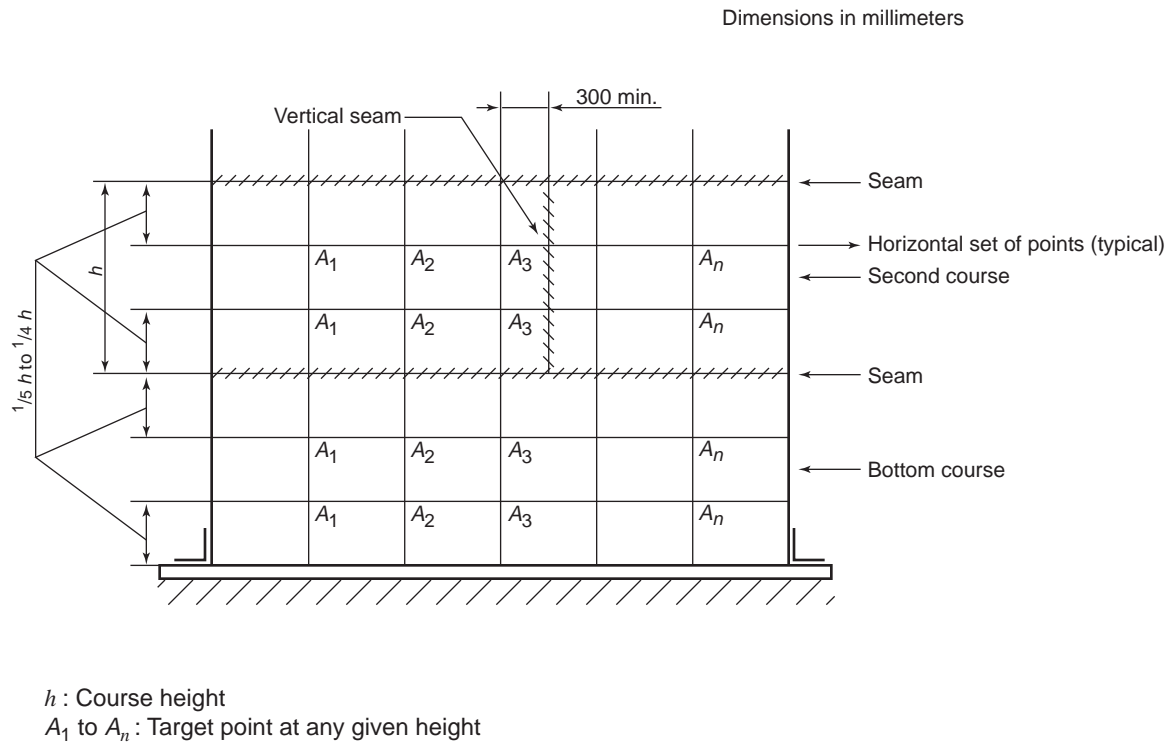


Figure 1—Illustration of Target Positioning on Tank Shell Wall

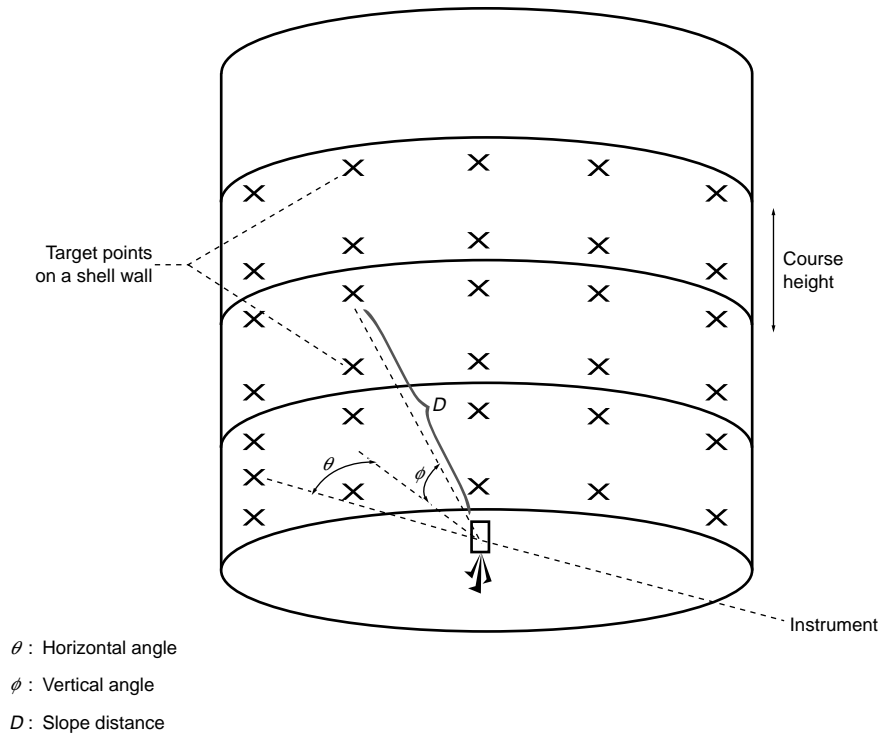


Figure 2—Illustration of Calibration Procedure

shall be measured using a dip tape and weight, in accordance with API *MPMS* Chapter 2.2A. This overall height, to the nearest millimeter, shall be marked on the tank adjacent to that dip hatch.

**11.3** The following data shall be determined and processed in accordance with API *MPMS* Chapter 2.2A.

- a. the density and the working temperature of the liquid to be stored in the tank;
- b. the height of each course;
- c. the thickness of each course of plating;
- d. the safe filling height and maximum filling height;
- e. deadwood;
- f. the tilt of the tank as shown by the deviation from a vertical line.

**11.4** The vertical height difference between the datum-point and the dip-point, if any, shall be measured by normal surveying methods and recorded.

Note 7: In use, each measured tank dip is referred to a dip-point; the position of the dip-point may differ from the datum-point used for the purpose of tank calibration (e.g. on the intersection of the tank shell and the tank bottom plate).

**11.5** If tank construction drawings are available, calibration measurements shall be compared with the corresponding dimensions shown in the tank construction drawings. Any measurements which show significant discrepancies shall be checked.

If the calibration and drawing measurements do not agree, the reasons for the discrepancy shall be determined and the calibration procedure repeated if necessary.

## **12 Calculation and Development of Capacity Tables**

**12.1** Calculate the internal radii of the tank by the procedures described in Appendix B.

**12.2** Once the internal radii are calculated, the development of the capacity table shall be carried out in accordance with API *MPMS* Chapter 2.2A. The following corrections, described in Chapter 2.2A, shall be applied in the development of the capacity tables:

- a. correction for hydrostatic head effect;
- b. correction to the certified tank shell temperature;
- c. correction for deadwood;
- d. correction for tilt.



## APPENDIX A—FIELD EQUIPMENT VERIFICATION

The following procedures provide a method of on-site verification of the equipment prior to, and on completion of, a calibration procedure.

The procedures shall be followed each time the instrument is switched on and brought to operating temperature, and on completion of any set of measurements at a measurement station.

### A.1 Angular Measurement Verification

**A.1.1** The following procedure assumes that the instrument has been verified prior to calibration using the procedures recommended by the manufacturer; it relies on the angular measurement accuracy of the EODR instrument.

Note 8: The angular measurement uncertainty of the instrument is normally adjusted to a minimum by the manufacturer.

**A.1.2** Set up the instrument, following the procedures described in Clause 7.

**A.1.3** Each particular EODR instrument will have manufacturer's instructions concerning collimation of both the vertical and horizontal angular measurement components of the instrument. These instructions shall be followed exactly, and the uncertainty of both the vertical and horizontal angular measurement components of the instrument calculated and recorded.

**A.1.4** The collimation uncertainty of both the horizontal and vertical components of the instrument shall not exceed  $\pm 0.001$  gon.

### A.2 Distance Measurement Verification

**A.2.1** Complete the procedures in A-1 before verifying the distance-measurement component of the instrument.

**A.2.2** Set up the stadia using the procedures given in API MPMS Chapter 2.2C.

**A.2.3** Place the stadia at a distance between 5 m and 15 m from the instrument and normal to an imaginary line between the instrument and the center mark of the stadia, as illustrated in Figure A-1.

**A.2.4** Using the EODR instrument, measure the horizontal angle  $2\theta$  subtended at the instrument by the two marks on the stadia.

**A.2.5** Calculate the horizontal Distance  $D$  (figure A-1 ) from the equation:

$$D = (B / 2) \times \cot \theta \quad \text{Equation A-1}$$

where  $B$  is the length, in meters, between the two reference marks on the stadia.

**A.2.6** Carry out the measurement of the angle and the calculation of the distance  $D$  a minimum of five times. The variations in the calculated distance  $D$  shall be within the tolerances given in Table 3 of API MPMS Chapter 2.2C or the entire procedure shall be repeated. Calculate and record the average values.

**A.2.7** The slope distance  $D$  measured by the EODR instrument and the average calculated distance  $D$  shall agree to within  $\pm 2$  mm.

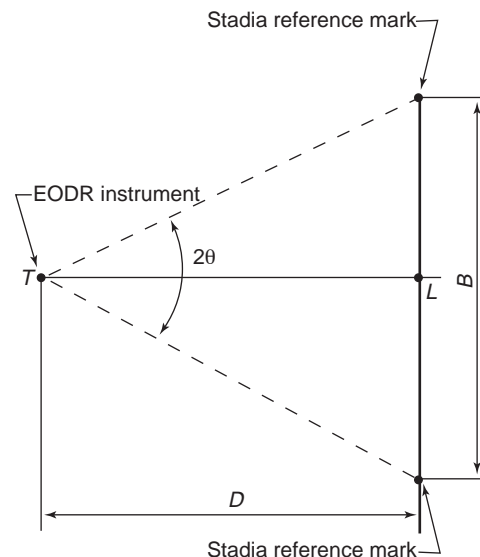


Figure A-1—Illustration of the Distance Measurement Setup





## APPENDIX B—CALCULATION OF INTERNAL RADII FROM MEASURED PARAMETERS

**B.1** The dimensional coordinates of each target point (see Figure 2) shall be converted to cartesian coordinates using the following equation:

$$X = [D][\cos \theta] [\cos \phi] \quad \text{Equation B-1}$$

$$Y = [D][\sin \theta] [\sin \phi] \quad \text{Equation B-2}$$

$$Z = [D] [\sin \phi] \quad \text{Equation B-3}$$

where:

$D$  = is the measured slope distance;

$\theta$  = is the measured horizontal angle;

$\phi$  = is the measured vertical angle.

**B.2** The calculation of the positions of the various target points at any one, horizontal, level is simplified if the vertical

height coordinates,  $Z$  values, are all reduced to a common level. Care shall be exercised in this reduction to ensure that the values of the  $Z$  coordinates are reduced to a common value which ensures that the adjusted positions of the target points are on a plane which is normal to the vertical axis of symmetry of the tank. It should not be assumed that the tank is truly vertical.

Alterations of the value of a  $Z$  coordinate will require a compensating alteration in the values of the  $X$  and  $Y$  coordinates of that point.

Such adjustments shall be carried out by established mathematical techniques.

**B.3** Reduction of the values of the  $X$  and  $Y$  coordinates to the internal radius at each level at which measurements have been taken shall be carried out by established mathematical techniques.



## APPENDIX C—BIBLIOGRAPHY

The following list of ISO standards contains information which may prove of use to the reader of this part of API MPMS Chapter 2.

- a. ISO 7507-2: 1993, *Petroleum and Liquid Petroleum Products—Calibration of Vertical Cylindrical Tanks—Part 2: Optical-reference-Line Method*.
- b. ISO 7078: 1985, *Building Construction—Procedures for Setting Out, Measurement and Surveying—Vocabulary and Guidance Notes*.
- c. ISO 8322-8: 1992, *Building Construction Measuring Instruments—Procedures for Determining Accuracy in Use—Part 8: Electronic Distance-measuring Instruments Up to 150 m*.



# 2003 Publications Order Form



Available through Global Engineering Documents.

Effective January 1, 2003.

**Phone Orders: 1-800-854-7179** (Toll-free in the U.S. and Canada)

**303-397-7956** (Local and International)

**Fax Orders: 303-397-2740**

**Online Orders: www.global.ihs.com**

**Date:** \_\_\_\_\_

☐ **API Member** (Check if Yes)

**Invoice To** (☐ Check here if same as "Ship To")

Name: \_\_\_\_\_

Title: \_\_\_\_\_

Company: \_\_\_\_\_

Department: \_\_\_\_\_

Address: \_\_\_\_\_

City: \_\_\_\_\_ State/Province: \_\_\_\_\_

Zip/Postal Code: \_\_\_\_\_ Country: \_\_\_\_\_

Telephone: \_\_\_\_\_

Fax: \_\_\_\_\_

E-Mail: \_\_\_\_\_

**Ship To** (UPS will not deliver to a P.O. Box)

Name: \_\_\_\_\_

Title: \_\_\_\_\_

Company: \_\_\_\_\_

Department: \_\_\_\_\_

Address: \_\_\_\_\_

City: \_\_\_\_\_ State/Province: \_\_\_\_\_

Zip/Postal Code: \_\_\_\_\_ Country: \_\_\_\_\_

Telephone: \_\_\_\_\_

Fax: \_\_\_\_\_

E-Mail: \_\_\_\_\_

Quantity	Product Number	Title	SO★	Unit Price	Total
	H022A1	MPMS Chapter 2.2A, Measurement and Calibration of Upright Cylindrical Tanks by the Manual Strapping Method		\$ 94.00	
	H30023	MPMS Chapter 2.2B, Calibration of Upright Cylindrical Tanks Using the Upright Cylindrical Method		59.00	
	H022C1	MPMS Chapter 2.2C, Calibration of Upright Cylindrical Tanks Using the Optical Triangulation Method		59.00	
	H30044	MPMS Chapter 2.7, Calibration of Barge Tanks		42.00	
	H30049	MPMS Chapter 2.8A, Calibration of Tanks on Ships and Oceangoing Barges		65.00	
	H25510	MPMS 2551, Measurement and Calibration of Horizontal Tanks		78.00	

☐ **Payment Enclosed** ☐ **P.O. No.** (Enclose Copy) \_\_\_\_\_

**Subtotal**

☐ **Charge My Global Account No.** \_\_\_\_\_

**Applicable Sales Tax** (see below)

**Rush Shipping Fee** (see below)

☐ **VISA** ☐ **MasterCard** ☐ **American Express** ☐ **Diners Club** ☐ **Discover**

**Shipping and Handling** (see below)

Credit Card No.: \_\_\_\_\_

**Total** (in U.S. Dollars)

Print Name (As It Appears on Card): \_\_\_\_\_

★ To be placed on Standing Order for future editions of this publication, place a check mark in the SO column and sign here:

Expiration Date: \_\_\_\_\_

Signature: \_\_\_\_\_

**Pricing and availability subject to change without notice.**

**Mail Orders** - Payment by check or money order in U.S. dollars is required except for established accounts. State and local taxes, \$10 processing fee\*, and 5% shipping must be added. Send mail orders to: **API Publications, Global Engineering Documents, 15 Inverness Way East, M/S C303B, Englewood, CO 80112-5776, USA.**

**Purchase Orders** - Purchase orders are accepted from established accounts. Invoice will include actual freight cost, a \$10 processing fee\*, plus state and local taxes.

**Telephone Orders** - If ordering by telephone, a \$10 processing fee\* and actual freight costs will be added to the order.

**Sales Tax** - All U.S. purchases must include applicable state and local sales tax. Customers claiming tax-exempt status must provide Global with a copy of their exemption certificate.

**Shipping** (U.S. Orders) - Orders shipped within the U.S. are sent via traceable means. Most orders are shipped the same day. Subscription updates are sent by First-Class Mail. Other options, including next-day service, air service, and fax transmission are available at additional cost. Call 1-800-854-7179 for more information.

**Shipping** (International Orders) - Standard international shipping is by air express courier service. Subscription updates are sent by World Mail. Normal delivery is 3-4 days from shipping date.

**Rush Shipping Fee** - Next Day Delivery orders charge is \$20 in addition to the carrier charges. Next Day Delivery orders must be placed by 2:00 p.m. MST to ensure overnight delivery.

**Returns** - All returns must be pre-approved by calling Global's Customer Service Department at 1-800-624-3974 for information and assistance. There may be a 15% restocking fee. Special order items, electronic documents, and age-dated materials are non-returnable.

**\*Minimum Order** - There is a \$50 minimum for all orders containing hardcopy documents. The \$50 minimum applies to the order subtotal including the \$10 processing fee, excluding any applicable taxes and freight charges. If the total cost of the documents on the order plus the \$10 processing fee is less than \$50, the processing fee will be increased to bring the order amount up to the \$50 minimum. This processing fee will be applied before any applicable deposit account, quantity or member discounts have been applied. There is no minimum for orders containing only electronically delivered documents.

# There's more where this came from.

The American Petroleum Institute provides additional resources and programs to the oil and natural gas industry which are based on API® Standards. For more information, contact:

- |   |  |
|---|--|
| • API Monogram® Licensing Program                         | Phone: 202-962-4791<br>Fax: 202-682-8070 |
| • American Petroleum Institute Quality Registrar (APIQR®) | Phone: 202-962-4791<br>Fax: 202-682-8070 |
| • API Spec Q1® Registration                               | Phone: 202-962-4791<br>Fax: 202-682-8070 |
| • API Perforator Design Registration                      | Phone: 202-962-4791<br>Fax: 202-682-8070 |
| • API Training Provider Certification Program             | Phone: 202-682-8490<br>Fax: 202-682-8070 |
| • Individual Certification Programs                       | Phone: 202-682-8161<br>Fax: 202-962-4739 |
| • Engine Oil Licensing and Certification System (EOLCS)   | Phone: 202-682-8233<br>Fax: 202-962-4739 |
| • Training/Workshops                                      | Phone: 202-682-8490<br>Fax: 202-682-8070 |

Check out the API Publications, Programs, and Services Catalog online at [www.api.org](http://www.api.org).



**American Petroleum Institute**

Helping You Get The Job Done Right.®



Additional copies are available through Global Engineering Documents at (800) 854-7179 or (303) 397-7956

Information about API Publications, Programs and Services is available on the World Wide Web at: <http://www.api.org>



**American  
Petroleum  
Institute**

1220 L Street, Northwest  
Washington, D.C. 20005-4070  
202-682-8000

Product No. H022D1