



Designation: C1589/C1589M – 17b

Standard Practice for Outdoor Weathering of Construction Seals and Sealants¹

This standard is issued under the fixed designation C1589/C1589M; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reappraisal. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reappraisal.

1. Scope

1.1 This practice describes outdoor exposure procedures to be used as part of a test designed to determine the weatherability of building construction, seals and sealants.

NOTE 1—See Practice G24 for Exposures to Daylight Filtered Through Glass.

1.2 This practice includes three procedures for outdoor weathering. Procedure A exposes specimens to outdoor weathering without movement. Procedure B and Procedure C are, respectively, continuous natural and periodic manual techniques for subjecting specimens to the combination of cyclic movement and exposure to outdoor weathering.

1.3 This practice is limited to the method by which the construction seals or sealants are exposed to outdoor weathering as part of a test program. It refers to the types of evaluations to be performed following the outdoor exposure but does not describe the test methods.

1.4 Means of evaluation of the effects of weathering will depend on the intended use of the test material.

1.5 The values stated in either SI units or inch-pound units are to be regarded separately as standard. The values stated in each system may not be exact equivalents; therefore, each system shall be used independently of the other. Combining values from the two systems may result in non-conformance with the standard.

1.6 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

1.7 *This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.*

¹ This practice is under the jurisdiction of ASTM Committee C24 on Building Seals and Sealants and is the direct responsibility of Subcommittee C24.40 on Weathering.

Current edition approved May 1, 2017. Published May 2017. Originally approved in 2004. Last previous edition approved in 2017 as C1589/C1589M-17a. DOI: 10.1520/C1589/C1589M-17B.

2. Referenced Documents

2.1 ASTM Standards:²

C717 Terminology of Building Seals and Sealants

C719 Test Method for Adhesion and Cohesion of Elastomeric Joint Sealants Under Cyclic Movement (Hockman Cycle)

C1135 Test Method for Determining Tensile Adhesion Properties of Structural Sealants

C1735 Test Method for Measuring the Time Dependent Modulus of Sealants Using Stress Relaxation

E631 Terminology of Building Constructions

E772 Terminology of Solar Energy Conversion

G7 Practice for Atmospheric Environmental Exposure Testing of Nonmetallic Materials

G24 Practice for Conducting Exposures to Daylight Filtered Through Glass

G84 Practice for Measurement of Time-of-Wetness on Surfaces Exposed to Wetting Conditions as in Atmospheric Corrosion Testing

G113 Terminology Relating to Natural and Artificial Weathering Tests of Nonmetallic Materials

G147 Practice for Conditioning and Handling of Nonmetallic Materials for Natural and Artificial Weathering Tests

G169 Guide for Application of Basic Statistical Methods to Weathering Tests

G178 Practice for Determining the Activation Spectrum of a Material (Wavelength Sensitivity to an Exposure Source) Using the Sharp Cut-On Filter or Spectrographic Technique

3. Terminology

3.1 *Definitions*—Definitions are found in Terminologies C717, G113, E631, and E772.

4. Significance and Use

4.1 Tests conducted in accordance with this practice are used to evaluate the weatherability of construction seals and sealant materials when they are exposed to outdoor weather conditions. The weatherability of seals and sealants in actual

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.



outdoor use can be very different depending on the location because of differences in solar radiation, moisture, temperature, pollutants, and other factors. Sealant color may also affect weatherability.

4.2 This practice allows for three options: Option 1 – Procedure A in which the effect of movement during weathering is not considered; Option 2 – Procedure B in which specimens are weathered in conjunction with movement based on thermal changes. The applied strain is proportional to a combination of the temperature at the time the equipment is set up and subsequent thermal changes. This option closely mimics the actual movements that occur in many sealant installations, but is less repeatable than the movement in Procedure C; Option 3 – Procedure C in which the strain during weathering is manually applied. This procedure allows for excellent control and repeatability, but is less representative of movement in actual use conditions than the movement in Procedure B. Options 2 and 3 have been added to this practice based on peer reviewed scientific literature demonstrating that applied strain separately and in combination with other weathering stresses causes changes in the weatherability of sealants.

4.3 The type, frequency and amount of movement of sealants varies with location and may affect weatherability. It cannot be assumed, therefore, that results from one exposure in a single location will be useful for determining weatherability in a different location. Exposures in several locations with different climates (for example, solar radiation, moisture, temperature, pollutants, biological and other factors) that represent a broad range of anticipated service conditions are recommended.

4.4 It is strongly recommended that control materials of similar composition and construction to the test specimens and with known weatherability be exposed along with the test specimens for the purpose of comparing the performance of test materials to the controls. (See 6.2).

4.5 The results of short-term exposure tests can provide an indication of relative outdoor performance, but they shall not be used to predict the absolute long-term performance of a seal or sealant material. The results of tests conducted for less than 12 months will depend on the particular season of the year in which they begin.

4.6 Because of year-to-year climatological variations, results from a single exposure test cannot be used to predict the absolute rate at which a seal or sealant degrades. Several years of repeat exposures are needed to determine an average test result for a given location.

4.7 Climatic and construction factors can impose cyclic movement upon sealed joints in use. This movement can impact the effects of outdoor weathering and often causes types of failure that are not produced by weathering without movement. Thus, the ability of building joint sealants to withstand temperature-induced movements of compression and expansion is an important property.

4.8 Outdoor weathering of specimens in combination with natural or forced cyclic movement during exposure can provide a more realistic assessment of the ability of a seal or sealant to

withstand the combined effects of climate and movement encountered by seals and sealants in building construction applications.

5. Test Sites and Exposure Racks

5.1 The test site shall conform to the requirements of Practice G7, and preferably, samples should be tested at a suitable number of climatologically different sites representing the variable conditions under which the construction seal or sealant will be used. Climatological variations within these areas may include those represented by desert, seashore (salt air), industrial locations, tropical, and subtropical regions, plus areas exhibiting a wide range of solar radiant energy. The area beneath and in the vicinity of the weathering racks shall be typical of the ground cover in that climatological area. In desert areas in which sand is the prevailing ground cover, coarse gravel is required to prevent abrasion and significant dust accretion due to wind-blown sand (Note 2). The ground cover shall be low-cut grass in most temperate, tropical, and subtropical areas.

NOTE 2—Sand as a ground cover may be desirable where the abrasive effects of exposure to wind-blown sand is a part of the desired exposure.

5.2 Weathering test racks shall be located in cleared areas. The racks and hardware shall conform to the requirements of Practice G7 and shall provide for the attachment of specimens or holders of any appropriate width and length. The structural members of the test racks shall not constitute a backing to the specimens under test. Fasteners used to attach specimens to the test rack shall provide for secure attachment but allow specimens to expand or contract with thermal changes, moisture absorption or desorption, or plasticizer loss.

5.3 Unless otherwise specified, position the racks at 45° relative to horizontal, facing the equator. The angle of the exposure rack, and the orientation relative to the equator can vary depending upon the in-service application of the material. Consult Practice G7 for information on other exposure rack orientations. If other rack orientations are used they must be reported.

6. Test Specimens

6.1 Follow the manufacturer's instructions for mixing or preparing, or both, materials to be tested. The specimens shall be cured under standard conditions as defined in Terminology C717. As far as practical, test specimens shall simulate those used in service conditions of an end-use application. When conditions of use are known, the specimen exposed will consist of seal or sealant material being evaluated plus suitable substrate or installation materials to conform to the projected practice. The effect of substrate or installation materials is highly significant and contributes to the degradation due to reflectance, heat absorption, moisture retention, etc.

6.2 It is recommended that a similar material of known performance under use conditions (a control) be exposed simultaneously with the test specimen for evaluation of the performance of the test materials relative to that of the control. It is preferable to use two control materials, one with relatively poor weatherability and the other with good weatherability. It

is strongly recommended that control materials and test materials be of the same dimensions.

6.3 The use of at least three replicate specimens of each experimental and control material being tested is recommended in order to allow for variability. Consult Guide **G169** for performing statistical analysis.

6.4 The total number of specimens will be determined by the number of exposure periods, number of replicates exposed, and the number of unexposed file specimens. When destructive tests are used to evaluate the effect of weathering, ensure that sufficient unexposed file specimens are retained to be tested each time the exposed materials are tested. These unexposed file specimens shall be retained at conditions of $23.0 \pm 2^\circ\text{C}$. They shall be covered with inert opaque wrapping to exclude light during the storage period.

6.5 Refer to Practice **G147** for procedures on specimen identification, handling and conditioning.

7. Specimen Holders

7.1 Specimen holders shall be used to support the specimens. In no case shall the specimen holder constitute a backing for that portion of the material to be evaluated.

7.2 The specimen holders shall be constructed of a material agreed upon by the mutual parties.

8. Instruments for Measuring Climatological Data

8.1 *Instruments Used to Measure Ambient Temperature and Relative Humidity*—Instrument and procedures used for measurement of ambient temperature and relative humidity shall be in accordance with Practice **G7**.

8.2 *Instruments Used to Measure Solar Radiation*—Instrument and calibration procedures used for measurement of total solar radiation, total solar ultraviolet radiation, or narrow band solar ultraviolet radiation shall be in accordance with Practice **G7**.

9. General Procedure

9.1 Mark the test specimens to be exposed with an identifying number, letter, or symbol so that they may be identified readily after exposure. The marking shall be such that there is no interference with either the exposure or the subsequent testing. (Preferably, mark both specimen and specimen holder on the side not exposed to weather, as extended exposure can obscure even deeply scribed marks.)

9.2 Record the initial appearance and physical-property data appropriate to the evaluation method used.

9.3 Mount the test specimens in the holder or directly to the exposure rack. It is convenient to group specimens to be removed from exposure at the same time in one holder.

9.4 Record a diagram of the test specimen holder layout, and record the date of installation and length of exposure planned.

9.5 Ensure that the pyranometer is mounted at a tilt and azimuth angle that is identical to that of the test specimens.

9.6 Mount the specimens on racks for the prescribed time, solar radiant energy, or total UV radiant energy or narrow band UV radiant energy.

9.7 Establish a fixed procedure of cleaning, visual examination, conditioning, and testing of the specimens. This procedure will vary with materials, but it must be uniform in a series of tests on one material to provide comparative results.

9.8 The face of the specimen shall not be masked for the purpose of showing the effects of various exposure times on one panel. Misleading results can be obtained by this method since the masked portion of the specimen is still exposed to temperature and humidity that will affect the results in many cases.

9.9 Unexposed file specimens shall be used for visual comparison to exposed specimens and for destructive tests compared with those of exposed specimens at various exposure stages.

9.10 Exposures and evaluations shall be planned to permit reporting one of the following for the test material(s) and control(s), if used:

9.10.1 Change after a specified exposure,

9.10.2 Amount of time for a specified change in properties to occur, and

9.10.3 A record of measurements after various exposure periods.

10. Exposure Procedures With and Without Movement

10.1 *Procedure A—Outdoor Weathering Without Movement*

10.1.1 *Test Specimens:*

10.1.1.1 Test specimens may be of any size or shape that can be mounted in a fixture, a holder or applied directly to the racks. The specimen dimensions can either be suited to the methods of evaluating the effects of weathering on specific properties, or larger from which smaller specimens for evaluation are cut. The exposure test specimens shall be large enough to allow for removal of the mounting edges, which would affect the evaluation of test results.

10.1.1.2 Test specimens can be made with any substrate. Standard substrates are glass, aluminum and concrete.

10.1.2 *Apparatus:*

10.1.2.1 Test racks and hardware shall conform to the requirements of Practice **G7** and shall provide for the attachment of specimens or holders of any convenient width and length. The structural members of the test racks shall not constitute a backing to the specimens under test.

10.1.2.2 Specimen holders shall be used to support the many sizes of specimens involved in this testing. The specimen holders shall be constructed of a material agreed upon by the mutual parties. Aluminum panels, glass, and marble shapes have been found suitable for static exposures. In no case shall the specimen holder constitute a backing for that portion of the material to be evaluated.

10.1.2.3 Fasteners used to attach specimens to the test rack shall provide for secure attachment but allow specimens to expand or contract with thermal changes, moisture absorption or desorption, or plasticizer loss.

10.2 Procedure B—Outdoor Weathering of Building Joint Sealants With Continuous Movement

10.2.1 Significance and Use:

10.2.1.1 The ability of building joint sealants to withstand daily and annual cycles of extension (tension) and compression caused by variations in the temperature of the sealants is an important property. This procedure defines a means of imposing temperature-induced cyclic movement of varying strain levels to specimens during exposure to outdoor weathering elements. The procedure applies to specimens whose size complies with the dimensions described in Test Method C719.

10.2.1.2 The extensions and compressions due to the pipe-induced movements will vary because of the daily and seasonal variations in ambient temperature and, most of the time, the extensions and compressions will be less than that of the full rated movement. However, the pipe-induced movement can produce weathering effects that more closely simulate in-service weathering than tests without movement.

NOTE 3—The device can be modified to obtain various levels of cyclic movement by changing the length of the pipe in consideration of the local weather conditions. The strain level imposed on the sealant will also depend on the temperature at the beginning of the experiment. For example, if the sealant exposure is started (zero level) on the hottest day of the year, all other temperatures will give either compression or tension depending on the design of the instrument. It is typically assumed that most sealant installations receive a balance of tension and compression during the year. Typical daily strains will be much less than the rated movement of the sealant. It is the seasonal changes in combination with the daily cycles that produce strains near the rated movement of the sealant.

10.2.1.3 The loss of sealant properties caused by this procedure depends on the season of the exposure and geographical location. Therefore, it cannot be assumed that a single exposure test can be used to predict the absolute rate at which loss of sealant properties occurs at one exposure site or to predict sealant property loss in a different location.

10.2.2 Apparatus—For additional details on description of equipment, see C. C. White, et. al, Review of Scientific

Instruments, 82, 025112 (2011).³ A detailed description of the apparatus is also included in an ASTM Research Report.⁴ Note that the apparatus described is only for 25 % movement in Gaithersburg, MD. The length of the pipe will differ for different movement classes or a different location.

10.2.2.1 Exposure Rack—The exposure rack shall consist of specimen holders, a fixed supporting frame, a movable frame and polyvinyl chloride (PVC) pipes, see Fig. 1a. It employs the difference in the coefficients of thermal expansion between the fixed supporting frame and PVC pipes to induce strain on sealant specimens.

10.2.2.2 Specimen Holder—The specimen holders shall be used to support the specimen geometry conforming to Test Method C719. They shall be constructed of a material agreed upon by mutual parties (aluminum alloy and stainless steel have been found suitable for this application) and consist of two U-shaped metal holders (Fig. 1b). The specimens of a material are placed inside the U-shaped holders, and two thumbscrews at the bottom of each U-shaped holder are used to hold the specimens in place. The specimen holders are attached to the stainless steel fixed supporting and movable frames using stainless steel rods so that at a high temperature, the PVC pipe expands causing specimen to be loaded in compression; while at a low temperature, the specimen will be loaded in extension (tension) (Fig. 2). The ends of the stainless steel rods are all threaded (M6 × 1 – this specifies the screw size and thread). In the middle of one of the rods between frame and specimen holders is a turnbuckle barrel for adjusting the length of the rod, and hence the extension (tension) of the specimen. All the connections are tightened using locking nuts (M6 × 1).

10.2.2.3 Fixed Supporting and Movable Frames—The support of the fixed frame shall be made of a material that is

³ Available from <http://rsi.aip.org/>

⁴ Supporting data have been filed at ASTM International Headquarters and may be obtained by requesting Research Report RR:C24-1062. Contact ASTM Customer Service at service@astm.org.


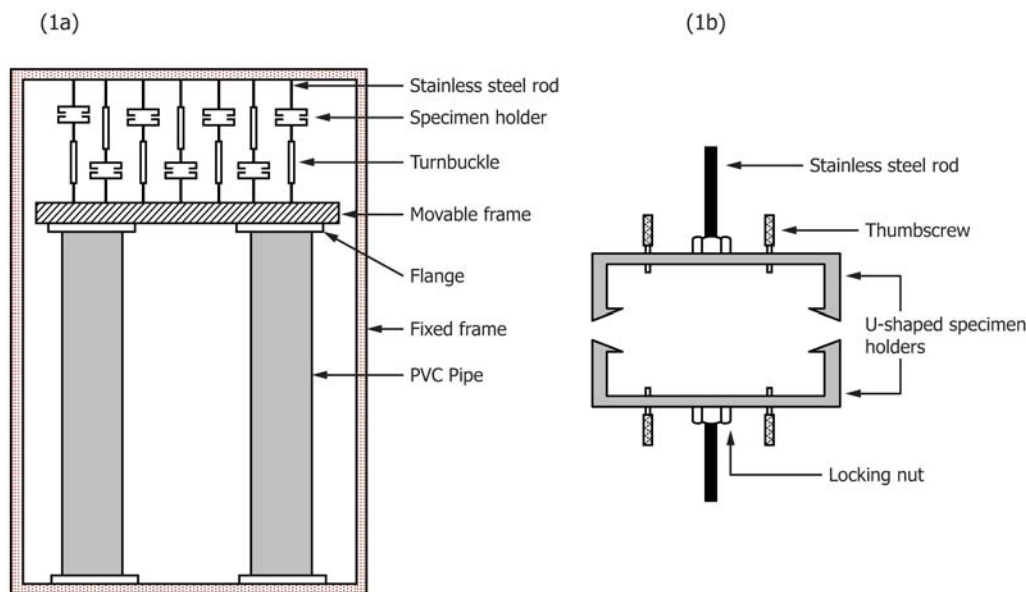


FIG. 1 (a) Schematic of Exposure Rack and (b) Specimen Holder (not to scale)

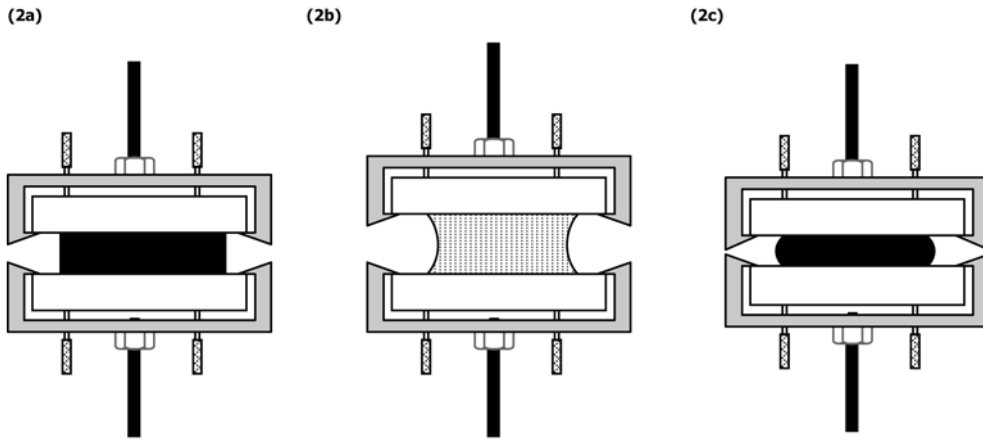

(a) at the intermediate temperature, the specimen is stress-free, (b) at a temperature below the intermediate temperature, the PVC pipes contract putting the specimen in extension (tension) and (c) at a temperature above the intermediate temperature, the PVC pipes expand causing the specimens to be in compression.

FIG. 2 Schematic of the Effect of Temperature on Movement of the Specimens (not to scale)

dimensionally insensitive to thermal variation. Hardwood (with cellulose fibers placed in the longitudinal directions) have been shown to be an effective, dimensionally temperature insensitive, material.

10.2.2.4 PVC Pipes—(These specifications only apply to materials rated for maximum strain of $\pm 25\%$ and tested in the Gaithersburg, MD area) – Two 101.6 mm [4 in.] diameter PVC pipes are used and their coefficient of thermal expansion, CTE, must be known or measured. Toilet flanges are used to attach the PVC pipes at the bottom to the fixed supporting frame and at the top to the movable frame. The length of the PVC pipe, L , which meets the requirement of imposing $\pm 25\%$ cyclic movement on specimens, is calculated as follows:

$$L = \frac{\Delta L}{CTE \times (T_{\max} - T_{\min})} \quad (1)$$

where:

- L = length of PVC pipe, m [in.],
- ΔL = total of movement of pipe between T_{\max} and T_{\min} , m [in.]: $\Delta L = 6.35 \times 10^{-3}$ m or $[\Delta L = 0.25 \text{ in.}]$,
- CTE = coefficient of thermal expansion, $^{\circ}\text{C}^{-1}[^{\circ}\text{F}^{-1}]$,
- T_{\max} = maximum temperature extreme expected in the exposure site, $^{\circ}\text{C}$ [F],
- T_{\min} = minimum temperature extreme expected in the exposure site, $^{\circ}\text{C}$ [F].

10.2.3 Specimen Thickness Change—In implementing the requirement of the $\pm 25\%$ strain limit for the 12.7 mm [0.5 in.] Test Method C719 specimen, note first that specimen thickness needs to change from 9.525 mm [0.375 in.] at the maximum temperature extreme (T_{\max}) expected at the exposure site to 15.875 mm [0.625 in.] at the corresponding minimum temperature extreme (T_{\min}), spanning a total movement of 6.35 mm [0.25 in.].

10.2.4 Test Procedure:

10.2.4.1 Ensure that the specimens are inscribed or otherwise labeled with an identifying number, letter or symbol. Specimen marking shall be in accordance with Practice G147 and shall be such that there is no interference with either the exposure or the subsequent testing.

10.2.4.2 Measure the initial physical properties of unexposed specimens. Typical properties measured are time-dependent moduli (in accordance with Test Method C1735) and visual appearance for any abnormalities, such as cracks, crazing, tears, and adhesion flaws.

10.2.4.3 Mount the specimens to be exposed to the specimen holders at the intermediate temperature, T , between the maximum and minimum temperature extremes expected in the exposure site. Exercise precautions to minimize axial misalignment. This intermediate temperature corresponds to the temperature at which the specimens are stress-free.

$$T = \frac{T_{\max} + T_{\min}}{2} \quad (2)$$

where:

T = intermediate temperature between T_{\max} and T_{\min} .

10.2.5 Evaluation of Exposure of Specimens:

10.2.5.1 After specimens are exposed for the desired amount of time, solar radiant energy, total ultraviolet radiant energy, or narrow band ultraviolet radiant energy, inspect the specimen to note the locus of joint failure, if any failure occurs.

10.2.5.2 Measure the properties of exposed specimens using the test methods as specified in 10.2.4.2.

10.3 Procedure C—Outdoor Weathering of Building Joint Sealants with Periodic Manual Extension and Compression

10.3.1 Test Specimens:

10.3.1.1 The number of specimens (replicates) for each test, the specimen dimensions, and the substrate preparation shall conform to Section 7 of Test Method C719. Also make an extra specimen for each set that will be kept at standard conditions (no outdoor exposure), but subjected to the same movement cycles as the other specimens. The sealant curing for all specimens shall be 28 days at standard conditions.

NOTE 4—Longer curing than specified in Test Method C719 is necessary to ensure that the sealant's properties have developed sufficiently to withstand the sustained extension or compression.

10.3.1.2 Test specimens can be made with any substrate. Standard substrates are glass, aluminum and concrete as per Test Method C719.

10.3.2 Apparatus:

10.3.2.1 Any clamping device can be used to hold specimens. An example of such a device for holding a specimen in tension or compression is shown in Fig. 3 and Fig. 4, respectively. Use 114.3 mm [4½ in.] aluminum (or stainless steel) bars drilled with holes near ends, near the top of the device, with 101.6 mm [4 in.] bolts and nuts to secure the bars. Insert a pair of casting spacers (such as nylon blocks) to ensure the test specimen is held at the desired neutral dimensions. Provide one pair of separators for each specimen for the extension dimension and one pair of separators for each specimen for the compression during the movement cycles.

10.3.2.2 Construct an outdoor exposure rack to hold the specimens; and example rack is shown in Fig. 5. Use hardware cloth or similar open-lattice backing to support the specimens without acting as a heat sink or reflector. Ensure that the rack is rigid enough that the specimens do not deflect the supporting material, changing their exposure angle. Orient the rack facing the equator and at an altitude angle of 45 degrees.

10.3.2.3 Modify a bench vise to extend the specimens. Ensure that the vise opens and closes smoothly and precisely, with little motion side-to-side or up-and-down, and does not use a spring in the opening direction. Fabricate grips that fit around the specimens from steel channel measuring 1.5 by 4 by ⅛ in. (3.8 by 10.1 by 0.3 cm) and attach them securely to the vice jaws.

NOTE 5—If specified by the user of the test results, changes may be made in the specimen geometry or other variables. For example, the sealant may have a 2:1 width-to-depth ratio instead of the geometry used in Test Method C719 (but be aware that the laboratory technique to form hourglass-shaped cross-sections has low repeatability). Other user-defined

variables may include curing time and method, in which season to start the specimen exposure, the percent compression and extension of the specimens, the number of compression/extension cycles per year, and the rack azimuth angle and direction. All such deviation from this standard shall be reported with the test results.

10.3.3 Test Procedure:

10.3.3.1 There are a variety of movement cycles that can be used. The most common is a yearly cycle in which the dimension is changed seasonally. After specimens are cured, they are placed on the exposure rack with the dimension dependent on the season. Specimens are placed in compression in the summer, in extension in the winter, and in the as-cured dimension (neutral) in the spring and fall. Change the dimension at the start of each season.

10.3.3.2 Cycles other than the yearly cycle are sometimes useful. Alternative movement cycles consist of change in position every week, every 2 weeks or every month. When these shorter cycles are used, the specimens are put on the rack after cure, first in extension, then neutral (as-cured position), followed by compression and then neutral. The result is accelerated damage, particularly that of adhesion and cohesion.

10.3.3.3 When changing specimen dimensions, the rate of movement should be relatively slow, moving no faster than 3 mm [0.118 in.] per minute.

10.3.3.4 The following summarizes the default annual cycle (see Note 5 regarding alternatives specified by the user of the test results):

(1) Compress the specimens 25 % from their neutral dimension, insert the smaller separator blocks, and tighten (snug) the specimen holders. Attach the specimens to the rack with nylon ties and commence exposure on approximately the Spring equinox.

(2) On approximately the Fall equinox, remove the specimens from the rack, remove the specimen holders, evaluate the



FIG. 3 Clamping Device Holding the Specimen in Compression

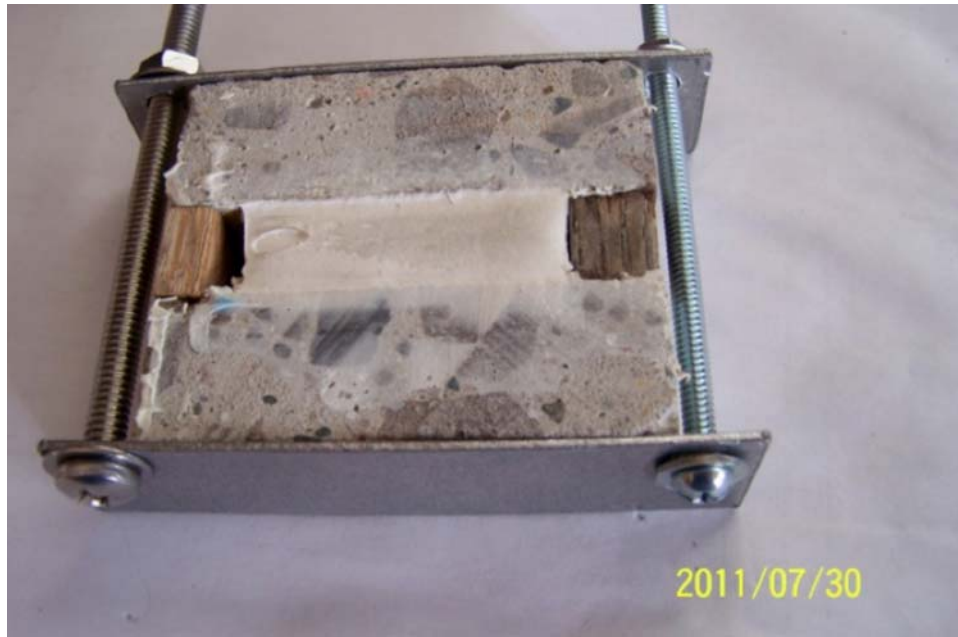


FIG. 4 Clamping Device Holding the Specimen in Extension (tension)



FIG. 5 Specimens Attached to Test Rack

specimen condition, extend the specimens 25 % from their neutral position using a vice as described above, insert the larger separator blocks, and reassemble the specimen holders. Secure the specimens to the rack and continue outdoor exposure.

(3) Repeat cycling the specimens seasonally on each equinox until failure occurs or the completion of at least 5 annual cycles.

10.3.4 Evaluation of Weathering:

10.3.4.1 After each change in dimension (extension and compression), examine the specimens for cracks, crazing, tears, adhesive and cohesive failure, color change, dirt pick-up, migration of fluids from the sealant into the substrate or onto the sealant surface, and other anomalies.

10.3.4.2 Optionally, the specimens can be tested for change in a physical property following the visual examination and after allowing the specimens to rest in an unstressed state for at least 24 h. A common test is the modulus, as described in Test

Method **C1135**. If modulus is measured, the value after the initial cure should be determined for a base line.

10.3.4.3 Along with any test results, report the condition of each specimen (per **10.3.4.1**) after each change in dimension (compression or extension). Also report all of the information listed in Section **12**, except **12.1.12** (however, report radiation data if known). Also report the sealant color and sealant curing time and method.

11. Exposure Stages for Procedures A, B and C

11.1 Use one of the following methods to specify the exposure stages at which changes in properties of test specimens are determined:

NOTE 6—The same exposure stage (by whichever method is used) will not necessarily give the same changes in properties of the test specimen at different exposure sites. The exposure stages must be regarded as providing only a general indication of the degree of exposure, and the results shall always be considered in terms of characteristics of the exposure site as well. The use of control materials exposed along with the test materials can aid in evaluating performance although test results may vary at different exposure sites.

11.1.1 *Exposure Time*—Specify the duration of the exposure in terms of months (1, 3, 6, 12, 15, etc.) or-years (1, 1.5, 2, 3, 4, 5, etc.), unless otherwise instructed.

NOTE 7—The results for exposure stages of less than one year will depend on the season of the year in which the exposure was made. For instance, summer exposures are generally more severe than winter exposures. Seasonal effects are reduced in exposures of several years, but the results may still depend on the particular season in which exposure was started (for example, exposures started in spring may exhibit more degradation than exposures started in autumn).

11.1.1.1 If available, record the total full spectrum solar radiant exposure and total solar UV radiant exposure that has been measured by radiometers positioned at the same tilt and azimuth angle as the test specimens.

11.1.1.2 *Solar-Radiation Measurements*—Since solar radiation is one of the most important factors in the deterioration of seals or sealants during weathering, exposure stages may be defined in terms of the amount of radiation received by the specimens. Total solar radiation, total solar ultraviolet radiation or narrow band solar ultraviolet radiation, are measured by radiometers positioned at the same tilt and azimuth angle as the test specimens. An inherent limitation to timing exposures based on solar radiation is that it does not reflect the variations in temperature and moisture, which are important weathering factors in conjunction with solar radiation.

11.1.2.1 *Total Full Spectrum Solar Radiation*—Measure total full spectrum solar (nominally 300 to 2500 nm) radiant exposure using the instrumentation described in Practice **G7**. The radiant energy measured shall be expressed in MJ/m².

11.1.2.2 *Total Solar Ultraviolet Radiation*—Measure total solar ultraviolet (295 to 385 nm) radiant exposure using the instrumentation described in Practice **G7**. The radiant energy measured shall be expressed in MJ/m². This is the recommended method for determining exposure stages.

11.1.2.3 *Specified Narrow-Band Solar Ultraviolet Radiation*—The UV radiant exposure in specified narrow wavelength intervals (or bands) that conform closely to the wavelengths to which the material is most sensitive may also

be used to follow the exposure stages. In order to identify the narrow band that conforms closely to the wavelengths to which the material is most sensitive, it may be necessary to determine the activation spectrum of the material based on exposure to solar radiation. A procedure for this has been described by N.D. Searle⁵ and is contained in Practice **G178**.

12. Report

12.1 Report the following information:

12.1.1 Laboratory name and location,

12.1.2 Site latitude,

12.1.3 Complete identification and description of the material tested, including type, source, manufacturer code number, and curing conditions employed,

12.1.4 Name and description of primers used, if any,

12.1.5 Complete identification and description of the substrate used,

12.1.6 Complete identification and description of the control material(s), if used, and the substrate,

12.1.7 Number of specimens of each material and control tested,

12.1.8 Exposure procedure, with or without movement. If with movement, specify whether manual or continuous,

12.1.9 Specimen mounting,

12.1.10 Angle of exposure (horizontal, at-latitude, 45° or 90°), and direction of exposure,

12.1.11 Duration of exposure of each specimen at each site, and dates of exposure.

12.1.12 *Solar Radiation*:

12.1.12.1 If available, total full spectrum solar radiant exposure (nominally 300 to 2500 nm) for each exposure stage, expressed in MJ/m².

12.1.12.2 If available, total UV radiant exposure (295 to 385 nm) for each exposure stage, expressed in MJ/m².

12.1.12.3 If available, solar UV radiant exposure measured in a narrow bandpass for each exposure stage including the bandpass in which the radiant exposure was measured.

12.1.13 Optionally, description of the climate at each site and summary of the pertinent climatological data at each site for the exposure period involved, as follows:

12.1.13.1 Rainfall,

12.1.13.2 If available, time of wetness (see Practice **G84**),

12.1.13.3 Temperature average and temperature extremes,

12.1.13.4 Humidity average and humidity extremes, and

12.1.13.5 Geographical location of the National Weather Service relative to the test site if climatological data is not measured at the test site.

NOTE 8—These data are intended as an indication of the climate at the test site, and the values reported are not to be used as absolute limits for any particular specimen on exposure.

12.1.14 Description of the type of failure, if any,

12.1.14.1 Cohesive failure if separation occurred within the material,

12.1.14.2 Adhesive failure if separation occurred at the interface of the substrate and sealant,

⁵ Searle N. D., "Activation Spectra of Polymers and Their Application to Stabilization and Stability Testing," *Handbook of Polymer Degradation*, 2nd Ed., S. H. Hamid, Ed., Marcel Dekker, New York, 2000, Chapter 16.

12.1.14.3 Mixed failure if both cohesive and adhesive failure are present,

12.1.14.4 Any cracks, crazing or other anomalies,

12.1.15 Tests of property changes,

12.1.15.1 Complete description or reference to test methods used to evaluate material properties,

12.1.15.2 Results of tests used to characterize the property of unexposed file specimens and specimens after exposure.

Report the average and standard deviation from each test used to measure change in properties of replicate specimens.

13. Keywords

13.1 construction seals; cyclic movement; cyclic fatigue; outdoor testing; outdoor weathering; sealants; stiffness; weathering; weathering with movement

APPENDIX

(Nonmandatory Information)

X1. PRACTICE FOR SETTING THE REFERENCE TEMPERATURE FOR AN ASTM 1589 METHOD B APPARATUS INDEPENDENT OF THE ACTUAL AMBIENT TEMPERATURE

X1.1 Apparatus

X1.1.1 *Adjustable Sealant Fixture*—A fixture composed of two sealant substrates connected by thin rods. These rods keep the two substrates aligned but allow for different distances. The separation of the substrates can be fixed by two thumb screws. See Fig. X1.1.

X1.1.2 *Set of Gauge Blocks*—A set of uniform gauge cylinders of different dimensions. For example, for Homestead Florida, the set of sixteen blocks are from 12.85 to 14.93 mm in size.

X1.2 Procedure

X1.2.1 Determine the desired reference temperature. One suggestion is to determine the highest temperature and lowest temperature for a specific geographic location. The midpoint temperature between these two temperatures can be used as the reference temperature.

X1.2.2 Determine the desired percent of extension change over the expected temperature range.

X1.2.3 Determine the ambient temperature to be used during the setting of the reference temperature.

X1.2.4 Calculate the expected percent extension of the sealant by the following expression:

$$\frac{(T_{\text{ambient}} - T_{\text{reference}})}{(T_{\text{high}} - T_{\text{reference}})} * E_{\text{total}} = E_{\text{ambient}} \quad (\text{X1.1})$$

where:

T_{ambient} = the current ambient temperature,
 $T_{\text{reference}}$ = the desired reference temperature,
 T_{high} = the highest expected temperature for the location over the expected duration of the exposure,
 E_{ambient} = the percent elongation at the reference temperature in decimal form, and
 E_{total} = the percent elongation expected over the entire duration of the exposure in decimal form (for example, 25 %).

X1.2.5 With the E_{ambient} calculated in X1.2.4 calculate the sample size at the ambient temperature by:

$$(E_{\text{ambient}} + 1) * H_{\text{initial}} = H_{\text{ambient}} \quad (\text{X1.2})$$

where:

H_{initial} = the height of the sample before exposure, typically 12.5 mm, and
 H_{ambient} = the height at the ambient temperature when installed in the sealant testing racks.

X1.2.6 Determine the gauge block closest to H_{ambient} and insert these gauge blocks into the adjustable sealant fixture.

X1.2.7 Adjust the adjustable sealant fixture so that both substrates touch the gauge blocks and use the thumb screws (see Fig. X1.1) to lock this dimension in place. The gauge blocks can be removed at this point.

X1.2.8 Use the adjustable sealant fixture now set in X1.2.7 to adjust the method B sealant racks to be neutral relative to the adjustable sealant fixture at the ambient temperature.

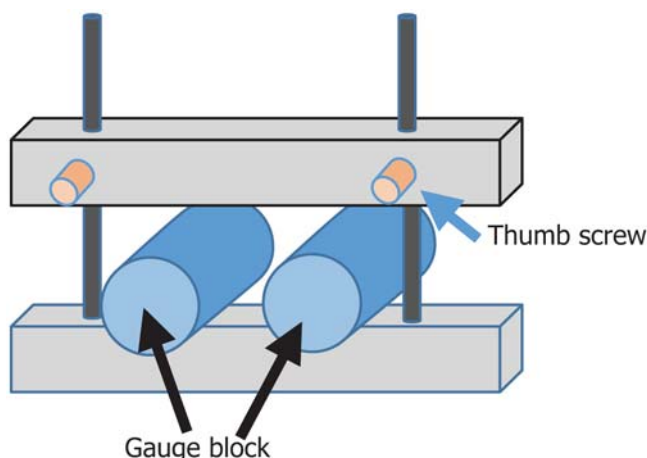


FIG. X1.1 An Illustration of the Adjustable Sealant Fixture



C1589/C1589M – 17b

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the Copyright Clearance Center, 222 Rosewood Drive, Danvers, MA 01923, Tel: (978) 646-2600; <http://www.copyright.com/>